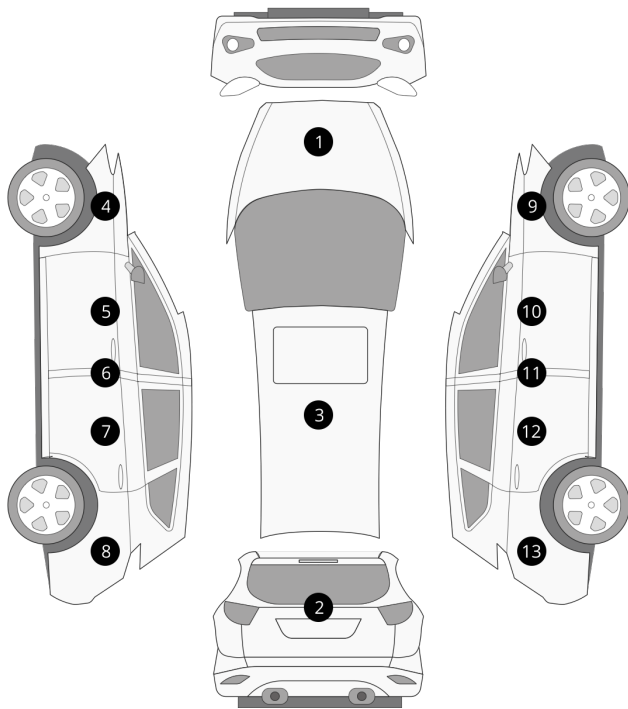


## General Information

Date & Time: 22, Apr, 2025 16:02

|                  |         |              |                   |
|------------------|---------|--------------|-------------------|
| Make             | Toyota  | Model        | Vios              |
| YOM              | 2024    | Mileage      | 30,031            |
| Registration No. | VAB9239 | Chassis No.  | PA1B18F30P4237164 |
| CC               | 1.3     | Transmission | CVT               |
| Fuel Type        | Gas     | Type of Body | Sedan             |
| Colour           | Silver  |              |                   |

## Body / Panel Condition



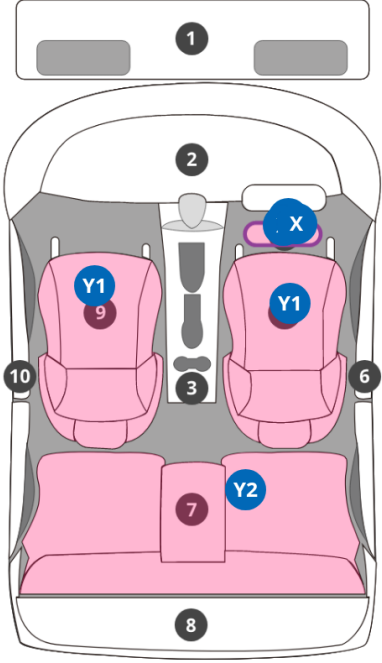
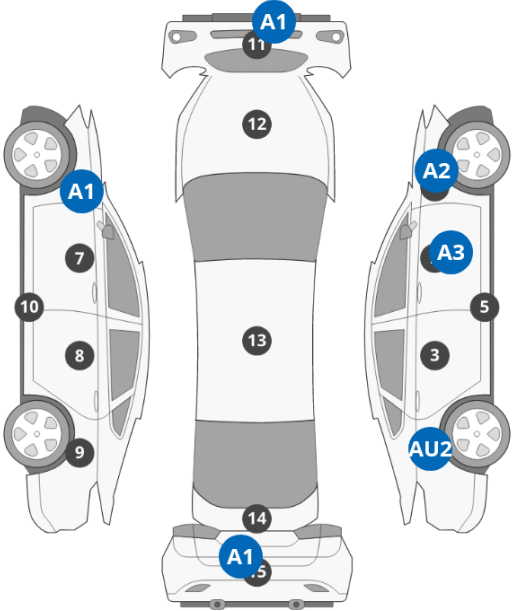
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 153.6         | 145    | 167    | 149      |
| 2  | Boot Lid           | 151.6         | 145    | 154    | 156      |
| 3  | Roof               | 148.5         | 156    | 148    | 143/147  |
| 4  | Left Front Fender  | 134.6         | 129    | 133    | 142      |
| 5  | Left Front Door    | 135.0         | 123    | 146    | 136      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 143.6         | 161    | 138    | 132      |
| 8  | Left Back Panel    | 148.0         | 152    | 152    | 140      |
| 9  | Right Front Fender | 143.3         | 149    | 144    | 137      |
| 10 | Right Front Door   | 136.3         | 138    | 131    | 140      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 147.6         | 137    | 140    | 166      |
| 13 | Right Back Panel   | 150.3         | 138    | 156    | 157      |

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

|                                                                                                                                                                                                                                                    |                                                                                                                                                                                                                                                                                                                                         |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Interior Evaluation :</b> <b>B</b>                                                                                                                                                                                                              | <b>Exterior Evaluation :</b> <b>B</b>                                                                                                                                                                                                                                                                                                   |
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p> |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p> |
| <b>Remarks</b><br>(L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Small / (R) Front Seat - Grime - Minimal                          | <b>Remarks</b><br>(R) Rear Fender, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium                            |
| <b>Frame Evaluation :</b> <b>A</b>                                                                                                                                                                                                                 | <b>Functional Evaluation :</b> <b>A</b>                                                                                                                                                                                                                                                                                                 |
| <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                | <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                                                                                                     |

| Inspector Notes                                                                   |
|-----------------------------------------------------------------------------------|
| with LTO plate/with spare tire/with jack and incomplete tools/No warranty booklet |