

General Information

Date & Time: 03, Apr, 2025 15:57

Make	Toyota	Model	Vios
YOM	2024	Mileage	23,640
Registration No.	CCA9361	Chassis No.	PA1B18F32R4260402
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



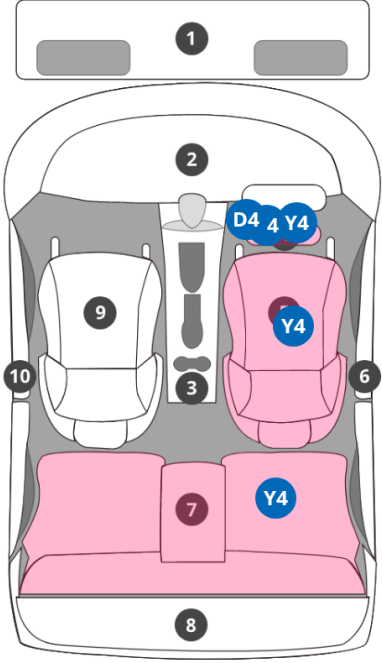
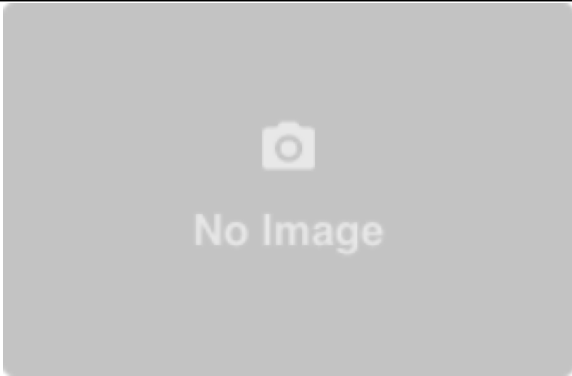
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	137.0	142	143	126
2	Boot Lid	94.7	98	91	96
3	Roof	100.2	104	97	95/105
4	Left Front Fender	92.8	93	89	96
5	Left Front Door	93.7	96	93	92
6	Center Panel Left				
7	Left Rear Door	93.0	94	96	89
8	Left Back Panel	105.3	113	101	102
9	Right Front Fender	293.3	138	602	140
10	Right Front Door	99.2	97	103	98
11	Center Panel Right				
12	Right Rear Door	98.4	95	97	103
13	Right Back Panel	102.0	95	103	108

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / Mat Other - Grime - Large / (R) Front Seat - Grime - Large / (R) Front Floor Mat - Grime - Large / (L) Front Floor Mat - Worked - Large	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Crack, Gap - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Defects not found

Inspector Notes
with warranty booklet/with spare tire and jack/with LTO plate and tools/