


General Information

Date & Time: 23, Apr, 2025 08:23

Make	Toyota	Model	Vios
YOM	2024	Mileage	30,586
Registration No.	NHM8942	Chassis No.	PA1B18F38R4248397
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition

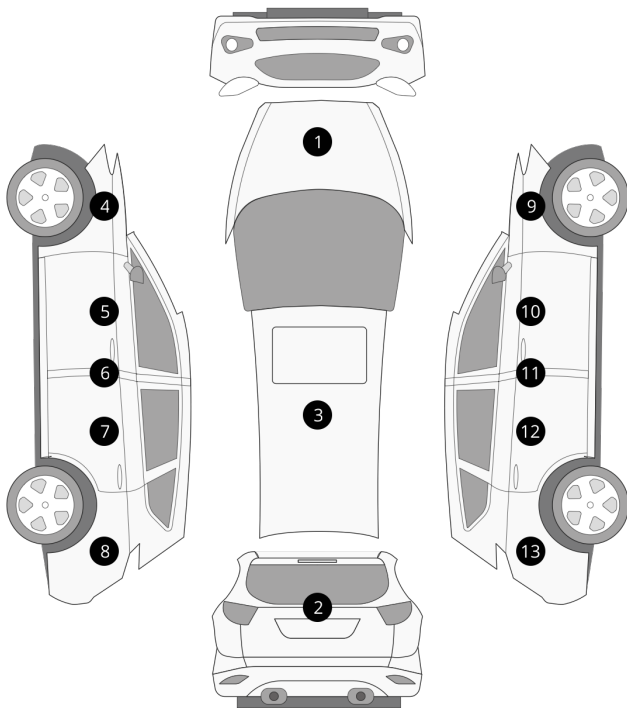

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.7	99	104	96
2	Boot Lid	88.1	90	83	91
3	Roof	94.6	95	95	88/101
4	Left Front Fender	88.9	85	91	91
5	Left Front Door	87.8	89	84	90
6	Center Panel Left				
7	Left Rear Door	92.8	93	95	91
8	Left Back Panel	93.6	99	97	85
9	Right Front Fender	96.5	93	100	97
10	Right Front Door	92.4	97	91	90
11	Center Panel Right				
12	Right Rear Door	96.7	91	97	102
13	Right Back Panel	95.8	87	103	98

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : E	Exterior Evaluation : E
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Mat Other - Missing - Yes / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Floor Mat - Worked - Large / (R) Front Floor Mat - Grime - Large / Ceiling - Cigarette Burns - Burnt, Hole / Ceiling - Grime - Small / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (L) Rear Trim - Cut, Crack - Small / (L) Front Trim - Grime - Small	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Member (Bolted) - Dent - Yes / (R) Mirror - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Crack, Gap - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium
Frame Evaluation : C	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, with jack and tools, with spare tire, with LTO plate