

General Information

Date & Time: 07, Apr, 2025 14:29

Make	Suzuki	Model	Dzire
YOM	2024	Mileage	22,617
Registration No.	NFS8048	Chassis No.	MBHZF63S9RG477014
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



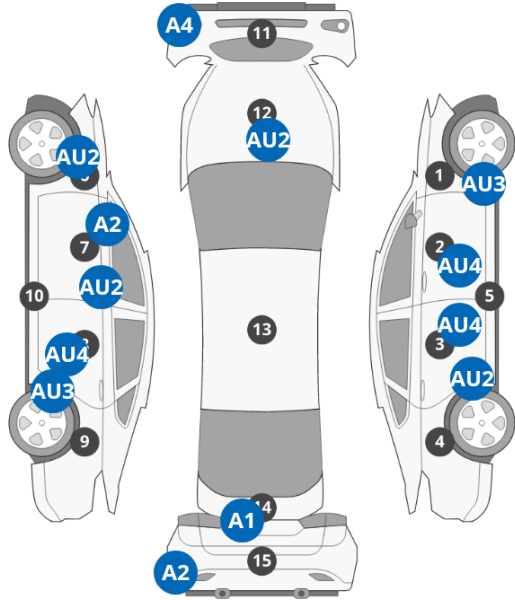
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.3	103	124	125
2	Boot Lid	67.2	73	66	63
3	Roof	107.5	102	102	115/111
4	Left Front Fender	102.6	92	109	107
5	Left Front Door	98.4	110	92	94
6	Center Panel Left				
7	Left Rear Door	89.2	94	89	85
8	Left Back Panel	97.5	101	100	92
9	Right Front Fender	106.5	113	108	99
10	Right Front Door	96.5	102	90	98
11	Center Panel Right				
12	Right Rear Door	91.0	78	97	99
13	Right Back Panel	94.8	91	94	100

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Traces of Adhesive Tape - Yes / (L) Front Seat - Grime - Minimal	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

with warranty booklet, no jack, no tools, with spare tire, with LTO plate, crack and scratches on tail light, signal light issue