

General Information

Date & Time: 15, Apr, 2025 08:18

Make	Toyota	Model	Vios
YOM	2024	Mileage	19,005
Registration No.	CCA9081	Chassis No.	PA1B18F30R4258437
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



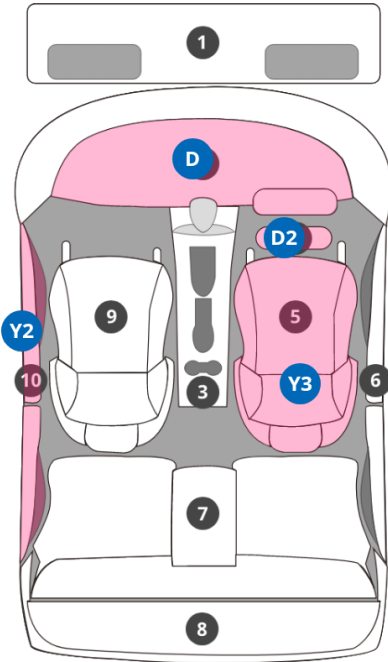
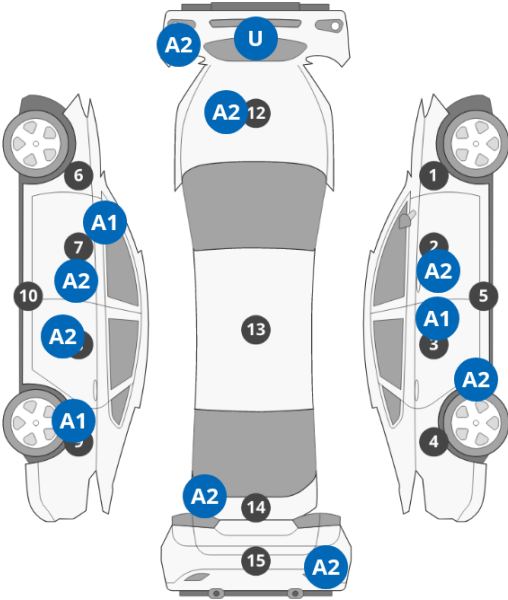
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	141.0	151	130	142
2	Boot Lid	90.8	88	94	90
3	Roof	143.5	124	214	108/128
4	Left Front Fender	134.6	135	130	139
5	Left Front Door	117.6	115	118	120
6	Center Panel Left				
7	Left Rear Door	124.3	134	132	107
8	Left Back Panel	102.8	120	100	88
9	Right Front Fender	145.3	144	139	153
10	Right Front Door	102.1	118	103	85
11	Center Panel Right				
12	Right Rear Door	96.0	97	95	96
13	Right Back Panel	110.8	71	126	136

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B		Exterior Evaluation : B	
			
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks (R) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes		Remarks Roof - Repair Traces - Yes / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small	
Frame Evaluation : A		Functional Evaluation : D	
Remarks Defects not found		Remarks Warning Lamps - Issue - Yes / Power Steering - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist	

Inspector Notes

with warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, weak battery, power steering issue due to weak battery, ABS warning lamp on