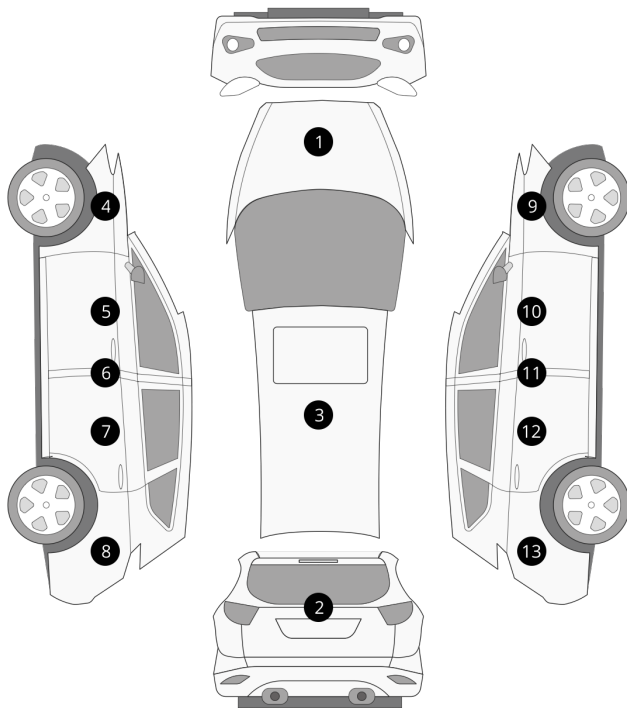


General Information

Date & Time: 11, Apr, 2025 15:12

Make	Toyota	Model	Vios
YOM	2025	Mileage	5,235
Registration No.	CCG4626	Chassis No.	PA1B18F33R4269898
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



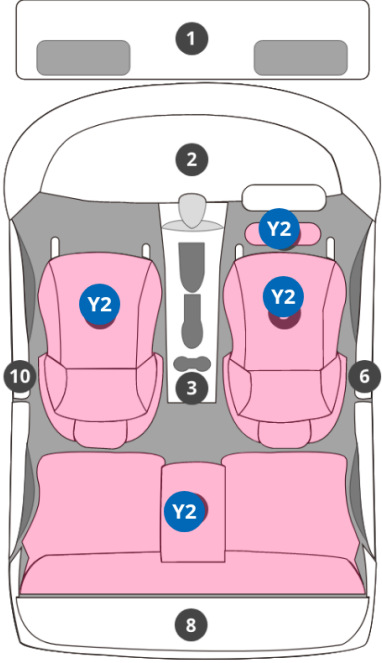
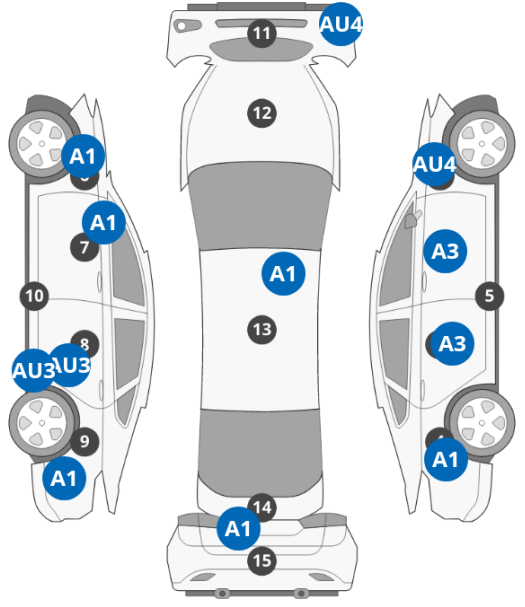
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	147.0	151	144	146
2	Boot Lid	104.2	100	103	110
3	Roof	114.2	137	140	109/71
4	Left Front Fender	132.0	140	127	129
5	Left Front Door	129.0	123	132	132
6	Center Panel Left				
7	Left Rear Door	130.6	149	128	115
8	Left Back Panel	118.3	133	118	104
9	Right Front Fender	144.6	154	136	144
10	Right Front Door	36.0	46	39	23
11	Center Panel Right				
12	Right Rear Door	60.4	68	56	57
13	Right Back Panel	86.8	82	87	92

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / Roof - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
with LTO plate/with spare tire/jack and tools/with warranty booklet