

General Information

Date & Time: 01, Jul, 2025 13:50

Make	Hyundai	Model	Starex
YOM	2019	Odo Meter Reading	49,542
Registration No.	NBH8887	Chassis No.	KMJWA37KBKU024086
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



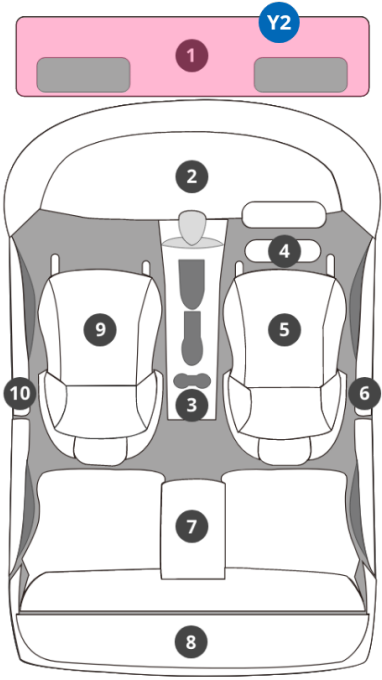
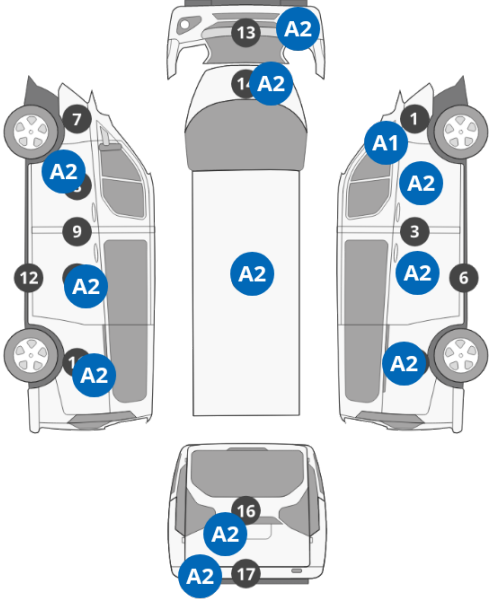
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.6	115	118	111
2	Boot Lid	162.0	171	165	150
3	Roof	117.7	109	101	132/129
4	Left Front Fender	111.6	115	110	110
5	Left Front Door	112.3	109	117	111
6	Center Panel Left				
7	Left Rear Door	108.0	106	116	102
8	Left Back Panel	118.3	114	116	125
9	Right Front Fender	102.6	100	106	102
10	Right Front Door	106.3	106	110	103
11	Center Panel Right				
12	Right Rear Door	108.2	116	109	100
13	Right Back Panel	109.6	108	117	104

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Ceiling - Grime - Small	Remarks (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Roof - Scratch - Small / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Door Lock - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate and Jack, Sparetire and incomplete tools. no warranty booklet and scratch tail lights and head lights.