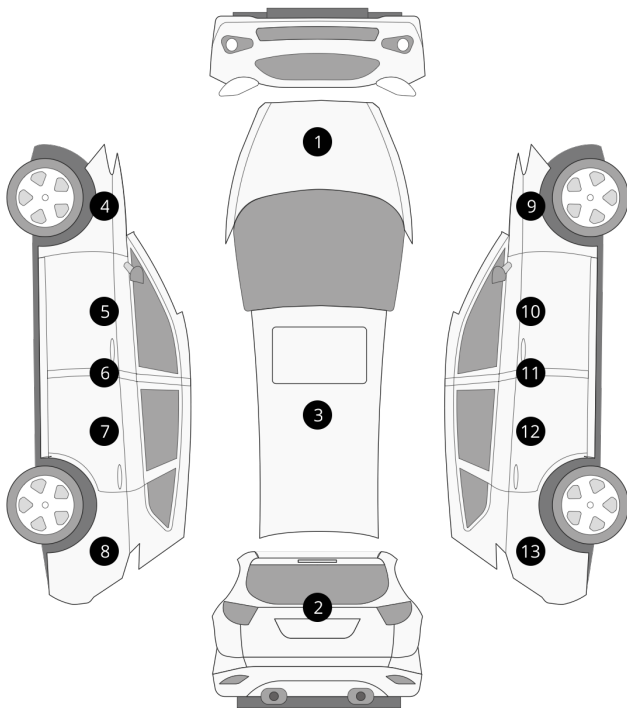


General Information

Date & Time: 21, Apr, 2025 13:52

Make	Toyota	Model	Vios
YOM	2024	Mileage	26,918
Registration No.	DBN7581	Chassis No.	PA1B18F33P4234646
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



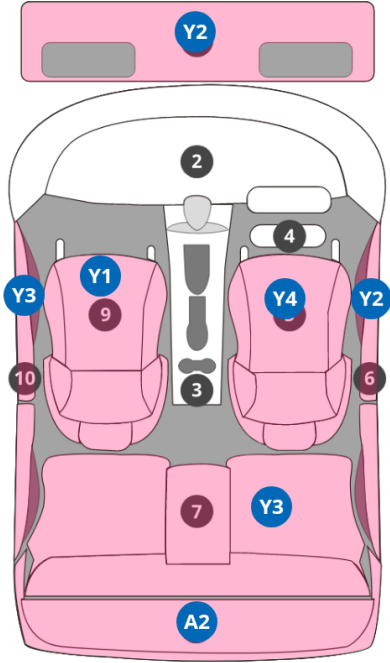
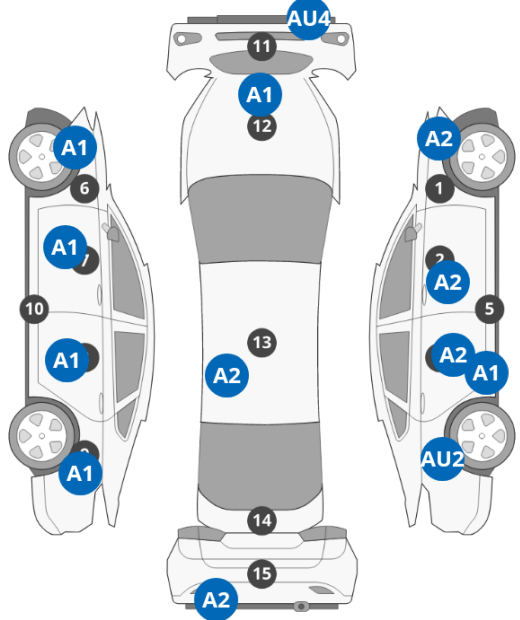
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	96.8	100	92	99
2	Boot Lid	94.2	91	92	99
3	Roof	84.1	88	85	80/84
4	Left Front Fender	87.6	90	83	90
5	Left Front Door	90.0	91	90	89
6	Center Panel Left				
7	Left Rear Door	89.4	92	88	89
8	Left Back Panel	95.8	100	99	89
9	Right Front Fender	87.6	90	84	90
10	Right Front Door	120.3	126	119	116
11	Center Panel Right				
12	Right Rear Door	90.5	96	88	88
13	Right Back Panel	91.7	86	90	100

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Medium / (R) Front Seat - Grime - Large / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small	Remarks (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Roof - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with warranty booklets/with jack and tools/No reverse camera/rear bumper re-painted