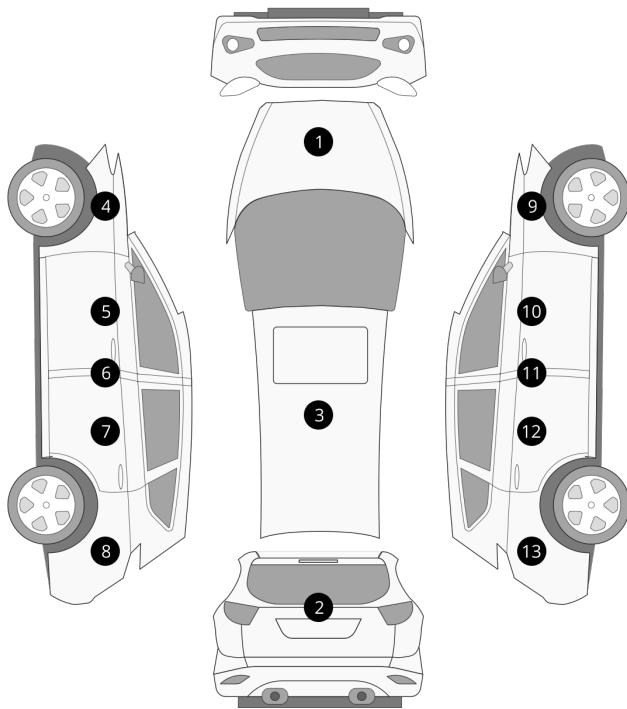


General Information

Date & Time: 15, Apr, 2025 13:25

Make	Toyota	Model	Vios
YOM	2024	Mileage	29,154
Registration No.	EAG6499	Chassis No.	PA1B18F32P4237618
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



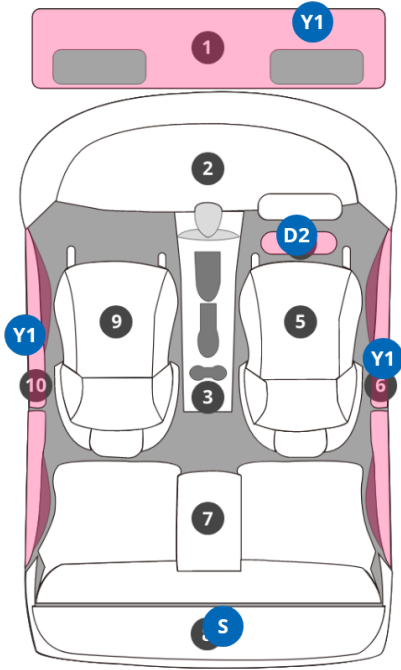
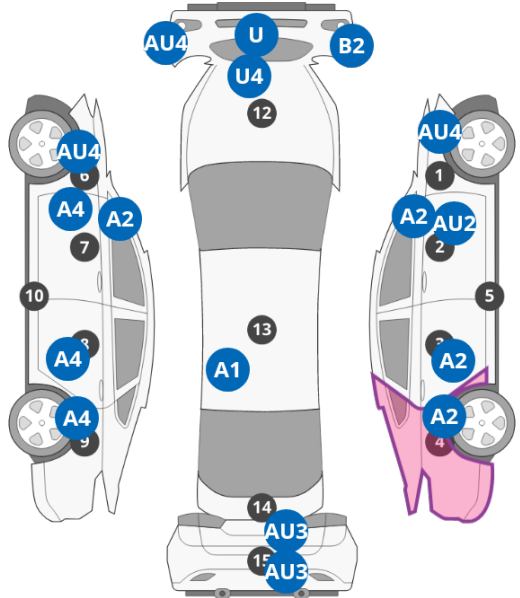
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	94.7	98	89	97
2	Boot Lid	88.3	84	90	90
3	Roof	90.1	92	97	80/92
4	Left Front Fender	84.5	87	80	86
5	Left Front Door	81.6	78	80	87
6	Center Panel Left				
7	Left Rear Door	87.0	93	90	78
8	Left Back Panel	89.7	98	91	80
9	Right Front Fender	88.7	88	89	90
10	Right Front Door	90.7	94	88	90
11	Center Panel Right				
12	Right Rear Door	92.7	91	87	100
13	Right Back Panel	92.9	88	94	97

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / Overall Interior - Smell - Yes	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Large / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Large / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Modified - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Dent - Large / Roof - Scratch - Minimal / (R) Rear Wheel, Cover - Cap Missing - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, gap on trunk hood, windshield washer clogged, worn tires