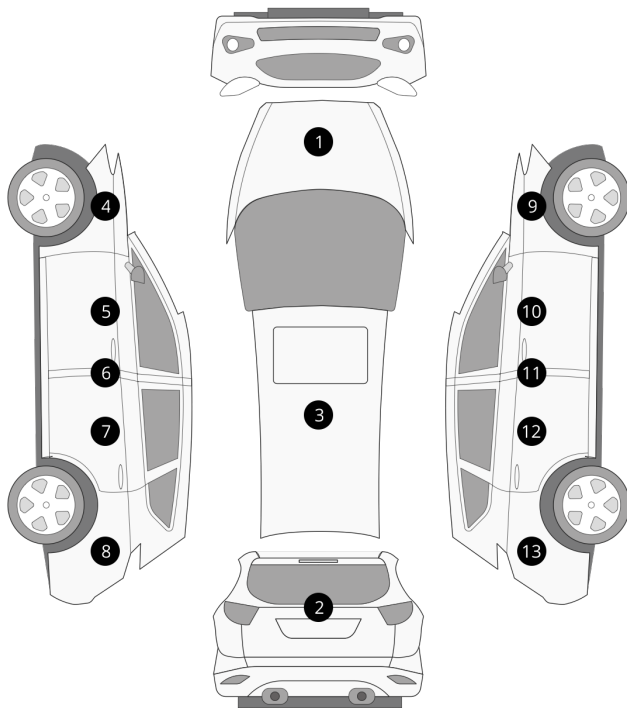


General Information

Date & Time: 21, Apr, 2025 15:44

Make	Toyota	Model	Vios
YOM	2024	Mileage	13,341
Registration No.	NFR7749	Chassis No.	PA1B18F30R4255957
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



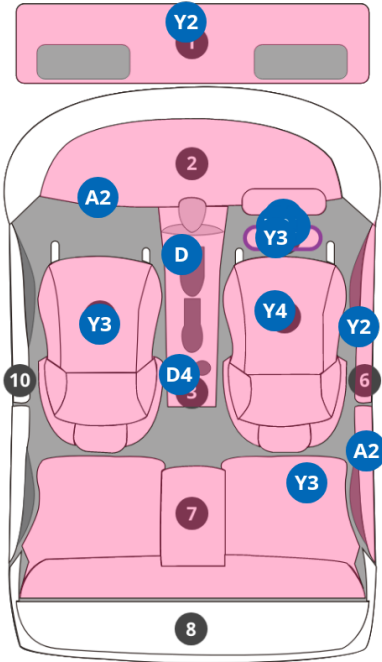
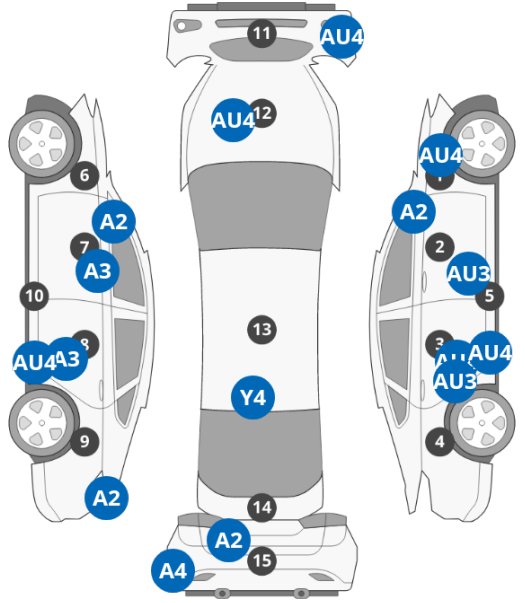
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.3	102	108	100
2	Boot Lid	98.8	93	101	102
3	Roof	94.4	100	90	88/100
4	Left Front Fender	86.0	85	86	87
5	Left Front Door	99.1	104	97	96
6	Center Panel Left				
7	Left Rear Door	96.8	103	97	90
8	Left Back Panel	99.5	109	98	92
9	Right Front Fender	94.1	97	91	95
10	Right Front Door	93.6	92	95	94
11	Center Panel Right				
12	Right Rear Door	96.3	96	94	100
13	Right Back Panel	94.0	92	91	99

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small / Rear Seat - Grime - Medium / Mat Other - Grime - Medium / (R) Rear Trim - Cut, Crack - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Grime - Medium / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / Steering Wheel - Worn, Peel, Crack - Small / Console, Switchs, Vents - Loose, Deformed - Large	Remarks Rear Windshield - Damaged - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Power Steering - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate (under passenger seat), scratches on tail light and head light, possible flooding