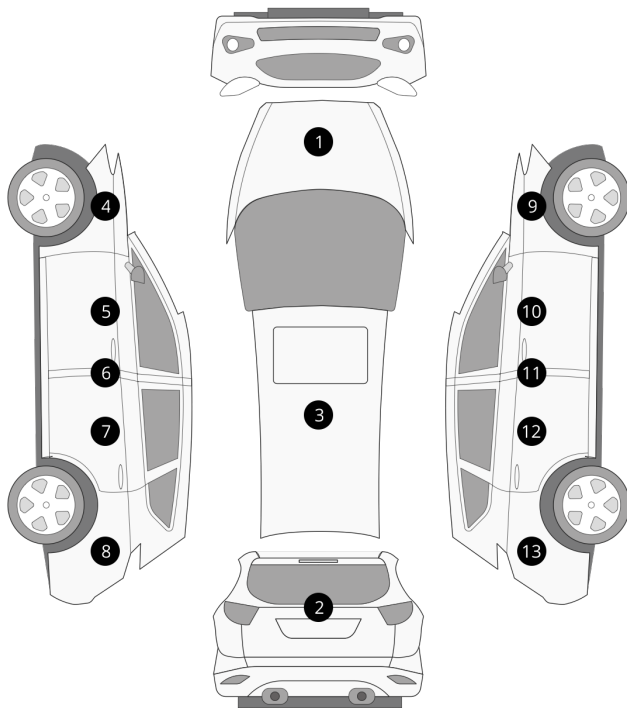


General Information

Date & Time: 23, Apr, 2025 14:05

Make	Toyota	Model	Vios
YOM	2024	Mileage	9,499
Registration No.	NFR4969	Chassis No.	PA1B18F34R4250857
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



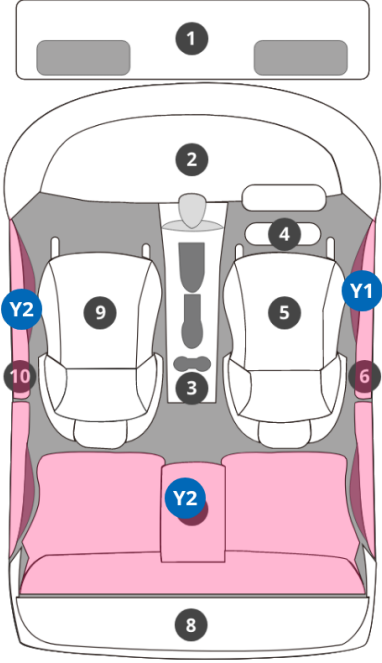
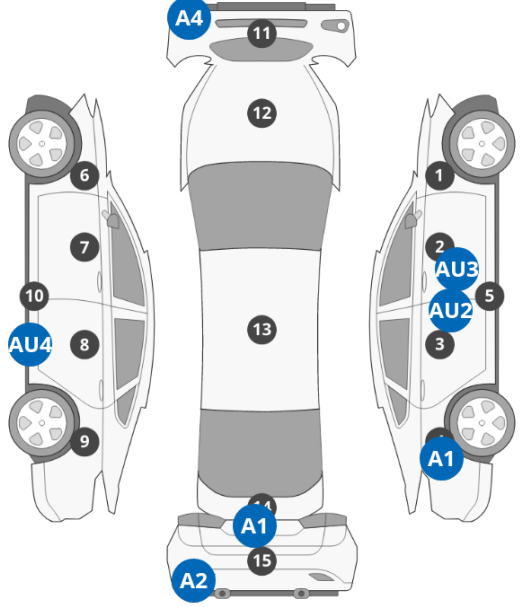
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.9	100	99	98
2	Boot Lid	95.4	91	97	98
3	Roof	91.3	99	89	87/90
4	Left Front Fender	90.8	90	91	92
5	Left Front Door	87.7	87	90	86
6	Center Panel Left				
7	Left Rear Door	93.4	103	91	87
8	Left Back Panel	99.6	106	100	93
9	Right Front Fender	99.0	95	91	111
10	Right Front Door	95.1	93	99	94
11	Center Panel Right				
12	Right Rear Door	98.6	98	95	103
13	Right Back Panel	97.5	99	90	103

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Small / Rear Seat - Grime - Small / (R) Front Trim - Grime - Minimal	Remarks Rear Bumper, Lamps, Panels - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch - Large / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Steering - Issue - Yes / Battery - Weak - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with tools No jack/No warranty booklet/ steering issue due to weak battery/ panel meter issue/ warning lamp issue due to week battery