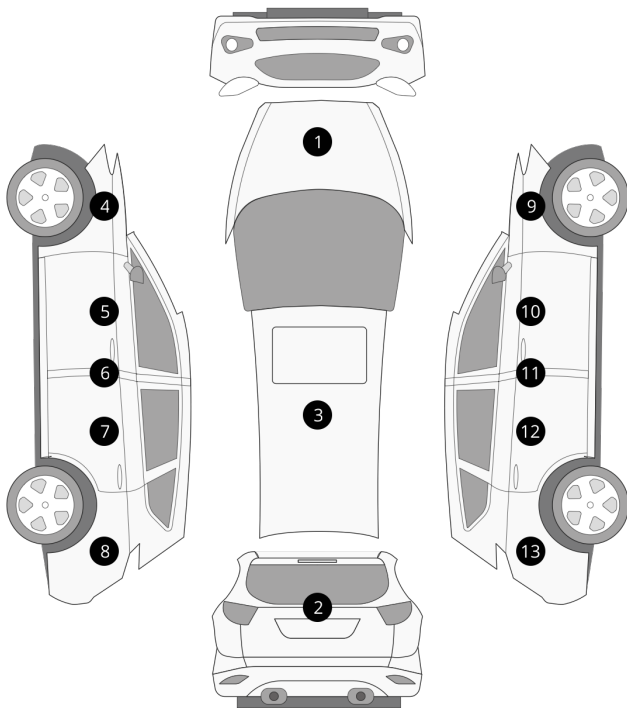


General Information

Date & Time: 21, Apr, 2025 08:59

Make	Toyota	Model	Vios
YOM	2024	Mileage	13,288
Registration No.	NHQ5020	Chassis No.	PA1B18F38R4245113
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



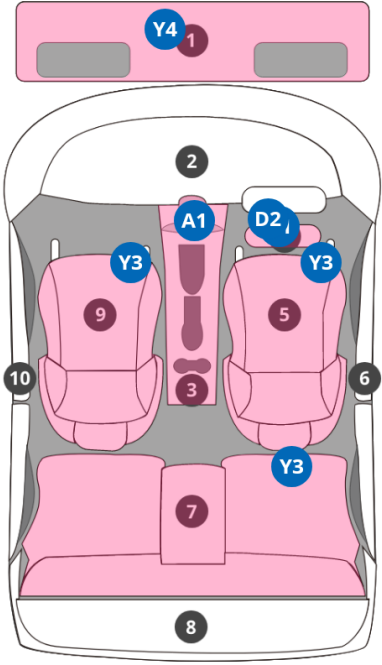
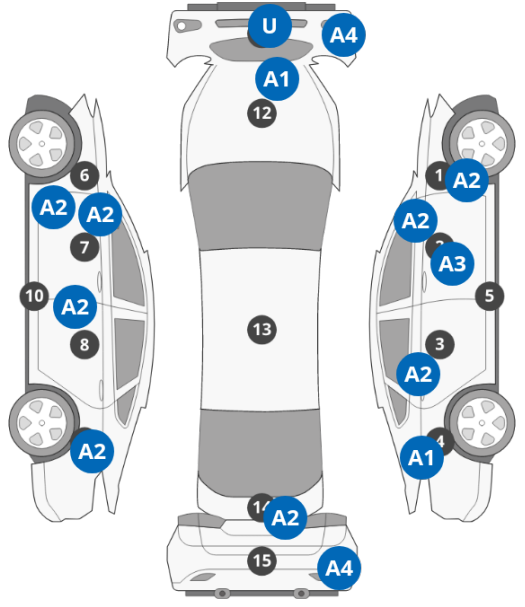
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.1	108	97	98
2	Boot Lid	100.5	89	113	99
3	Roof	90.7	93	92	86/92
4	Left Front Fender	85.1	88	82	85
5	Left Front Door	85.8	85	86	87
6	Center Panel Left				
7	Left Rear Door	88.8	90	88	88
8	Left Back Panel	96.7	105	91	95
9	Right Front Fender	90.7	94	85	93
10	Right Front Door	89.7	88	90	91
11	Center Panel Right				
12	Right Rear Door	93.9	93	92	97
13	Right Back Panel	90.6	86	95	91

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Minimal / (L) Front Floor Mat - Worked - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Minimal / Ceiling - Grime - Large	Remarks (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

no warranty booklet, with jack, no tools, with spare tire, with LTO plate