

General Information

Date & Time: 15, Apr, 2025 10:14

Make	Toyota	Model	Vios
YOM	2024	Mileage	9,488
Registration No.	NIT8244	Chassis No.	PA1B18F34P4226992
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



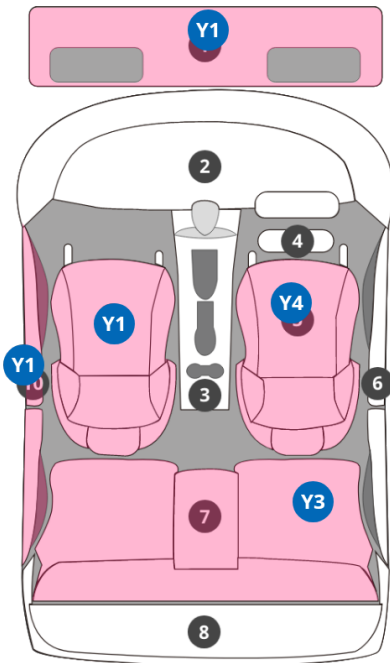
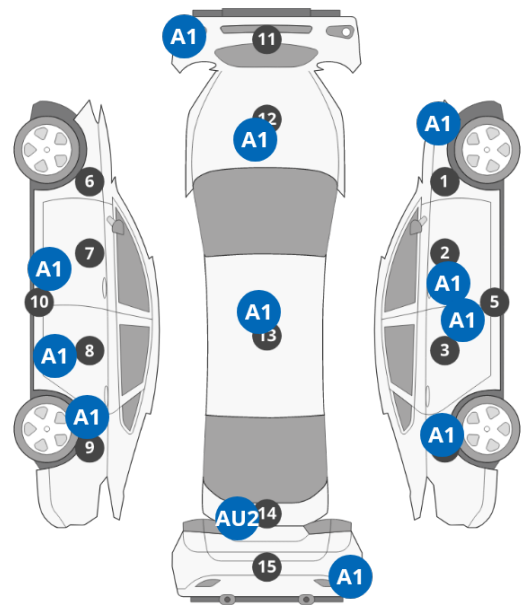
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.9	108	87	117
2	Boot Lid	95.8	90	98	100
3	Roof	86.7	87	92	82/85
4	Left Front Fender	86.6	85	82	93
5	Left Front Door	91.1	90	94	89
6	Center Panel Left				
7	Left Rear Door	89.2	87	91	90
8	Left Back Panel	97.0	104	95	92
9	Right Front Fender	89.8	89	87	94
10	Right Front Door	88.1	88	92	85
11	Center Panel Right				
12	Right Rear Door	91.1	96	84	94
13	Right Back Panel	97.3	90	91	111

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / (L) Front Trim - Grime - Minimal / Rear Seat - Grime - Medium / Ceiling - Grime - Minimal / (L) Front Seat - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate, no warranty booklet, with jack ,Incomplete tools, with spare tire, asphalt splatter on rear bumper