

General Information

Date & Time: 10, Apr, 2025 15:47

Make	Toyota	Model	Vios
YOM	2024	Mileage	14,911
Registration No.	NKE9970	Chassis No.	PA1B18F38R4257648
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



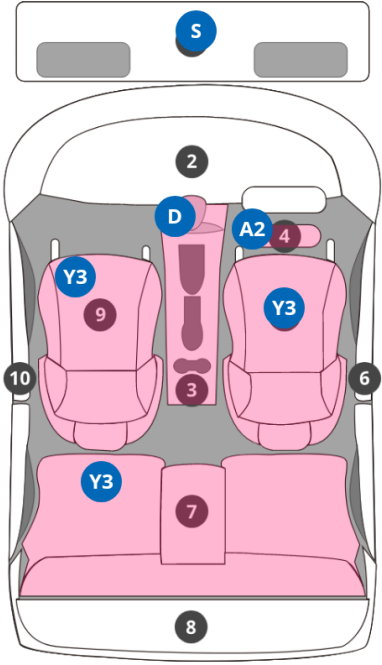
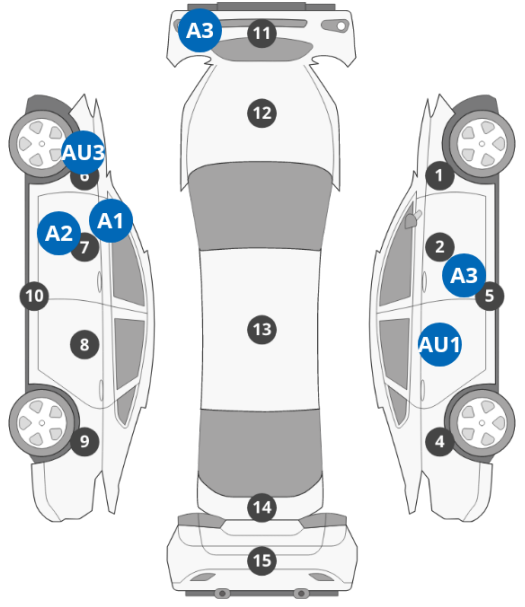
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.6	106	100	111
2	Boot Lid	106.3	104	108	107
3	Roof	101.5	105	96	99/106
4	Left Front Fender	99.0	102	100	96
5	Left Front Door	95.5	94	93	99
6	Center Panel Left				
7	Left Rear Door	110.3	117	114	100
8	Left Back Panel	111.0	132	98	103
9	Right Front Fender	101.3	100	104	100
10	Right Front Door	93.9	95	92	95
11	Center Panel Right				
12	Right Rear Door	152.3	148	146	163
13	Right Back Panel	113.0	104	103	132

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Small / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / (L) Front Seat - Grime - Medium	Remarks (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
Possible flooding. With warranty booklet, jack and incomplete tools. Without Spare tire. With LTO plate.