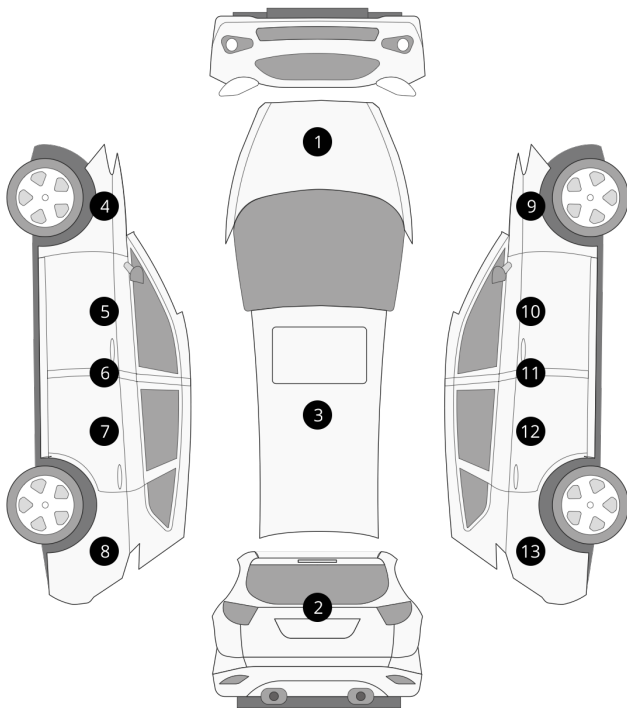


General Information

Date & Time: 10, Apr, 2025 10:17

Make	Toyota	Model	Vios
YOM	2023	Mileage	56,644
Registration No.	DAS5655	Chassis No.	PA1B18F37N4192754
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



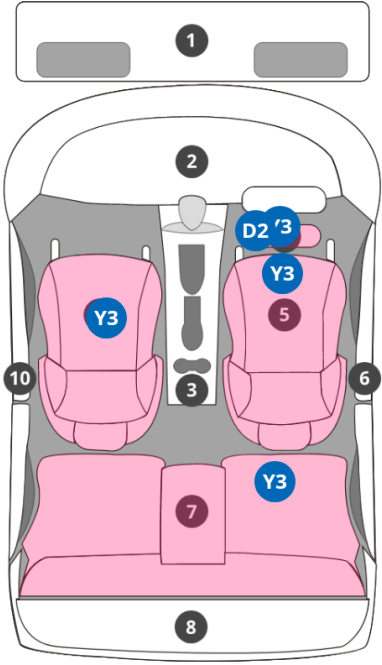
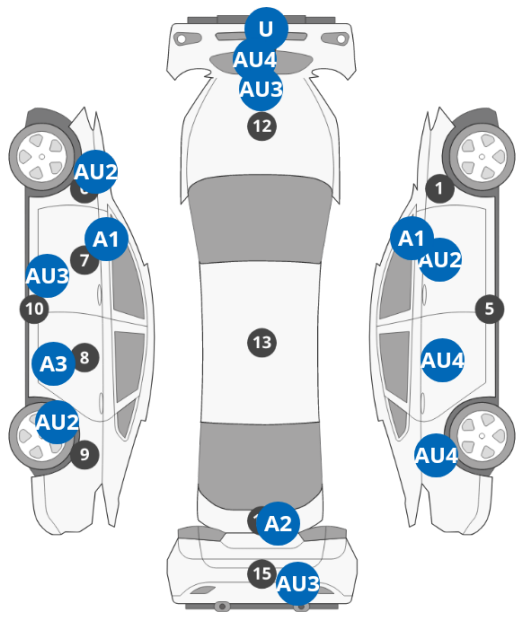
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	105	108	111
2	Boot Lid	102.0	100	100	106
3	Roof	91.6	102	80	90/94
4	Left Front Fender	100.2	102	99	100
5	Left Front Door	98.1	98	98	98
6	Center Panel Left				
7	Left Rear Door	99.3	102	98	98
8	Left Back Panel	100.9	111	96	96
9	Right Front Fender	96.3	95	97	98
10	Right Front Door	93.0	94	92	93
11	Center Panel Right				
12	Right Rear Door	92.8	93	91	94
13	Right Back Panel	94.2	91	91	101

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Mat Other - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small	Remarks Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal
Frame Evaluation : D	Functional Evaluation : B
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside (Rear Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

Gap at front bumper and bonnet. Left parklight issue. Bonnet cannot fully open. With warranty booklet, spare tire, jack and incomplete tools. With LTO plate.