

General Information

Date & Time: 05, Apr, 2025 09:45

Make	Toyota	Model	Vios
YOM	2023	Mileage	26,714
Registration No.	NHI7010	Chassis No.	PA1B18F32P4209477
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



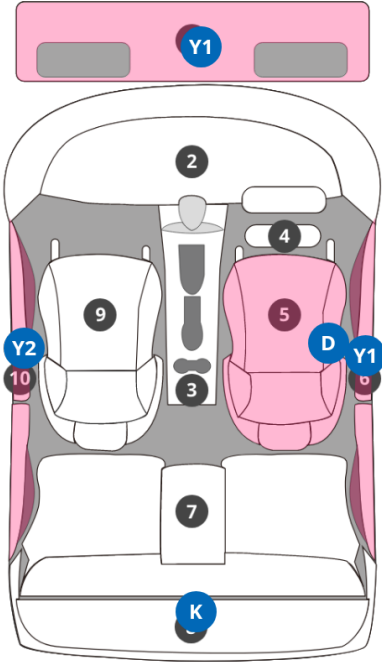
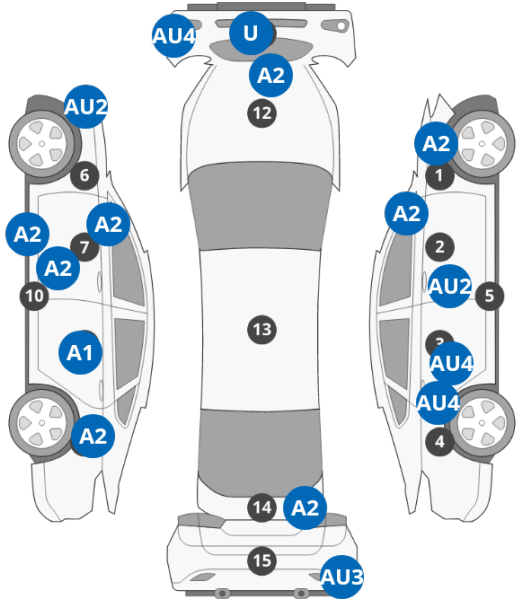
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	124.0	136	120	116
2	Boot Lid	111.3	113	109	112
3	Roof	103.9	111	102	94/109
4	Left Front Fender	96.7	102	95	93
5	Left Front Door	101.3	100	106	98
6	Center Panel Left				
7	Left Rear Door	94.5	103	92	88
8	Left Back Panel	104.9	107	109	99
9	Right Front Fender	109.0	104	112	111
10	Right Front Door	99.8	103	98	99
11	Center Panel Right				
12	Right Rear Door	187.6	168	215	180
13	Right Back Panel	116.0	119	111	118

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / (R) Front Seat - Worn - Yes / Overall Interior - Animal Hair - Yes / Ceiling - Grime - Minimal	Remarks (R) Rear Door - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack and tools, with spare tire, with LTO plate, crack left headlight, scratch on left tail light, battery weak, power steering issue due to weak battery