

General Information

Date & Time: 15, Apr, 2025 13:25

Make	Toyota	Model	Vios
YOM	2024	Mileage	9,458
Registration No.	NHM9219	Chassis No.	PA1B18F33R4243933
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



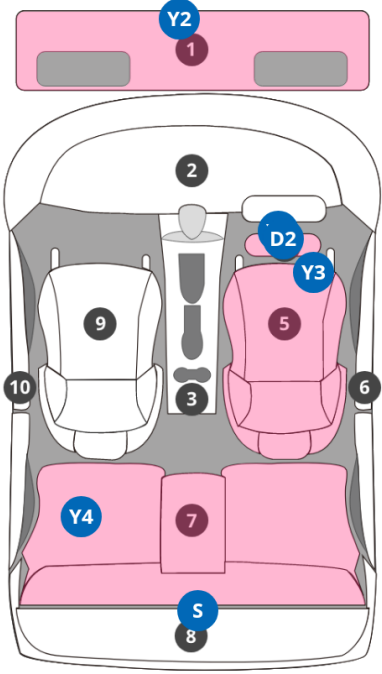
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.2	102	100	99
2	Boot Lid	94.0	91	84	107
3	Roof	94.7	95	94	86/103
4	Left Front Fender	86.8	85	84	91
5	Left Front Door	89.9	92	89	89
6	Center Panel Left				
7	Left Rear Door	88.4	92	88	85
8	Left Back Panel	93.8	94	94	93
9	Right Front Fender	96.9	97	96	98
10	Right Front Door	94.9	94	95	96
11	Center Panel Right				
12	Right Rear Door	99.1	94	92	111
13	Right Back Panel	99.4	103	96	99

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / Overall Interior - Smell - Yes	Remarks (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Roof - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light