


General Information

Date & Time: 22, Apr, 2025 13:34

Make	Toyota	Model	Vios
YOM	2024	Mileage	8,466
Registration No.	EAJ4295	Chassis No.	PA1B18F39R4254287
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition

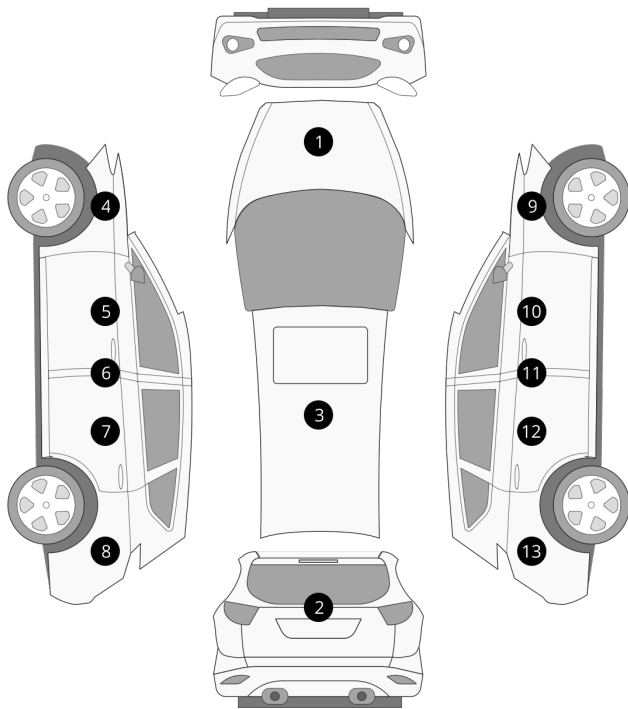


#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.3	105	102	103
2	Boot Lid	93.2	94	89	97
3	Roof	95.3	100	99	84/99
4	Left Front Fender	84.4	86	87	80
5	Left Front Door	128.0	107	166	111
6	Center Panel Left				
7	Left Rear Door	92.4	102	92	84
8	Left Back Panel	93.1	101	91	87
9	Right Front Fender	91.2	90	85	99
10	Right Front Door	90.3	95	92	84
11	Center Panel Right				
12	Right Rear Door	94.8	89	92	104
13	Right Back Panel	102.8	95	97	117

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

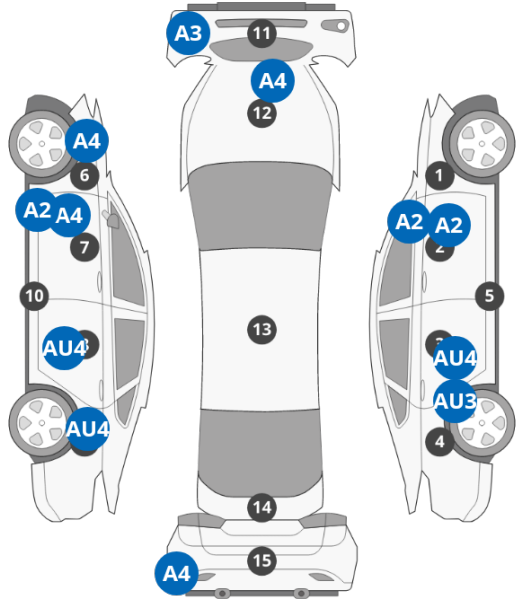Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Small / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Large / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Large	Remarks (L) Front Door - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with warranty booklet, with jack and tools, with spare tire, with LTO plate