

General Information

Date & Time: 14, Apr, 2025 15:59

Make	Toyota	Model	Vios
YOM	2024	Mileage	8,742
Registration No.	NFR8602	Chassis No.	PA1B18F3XR4258574
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



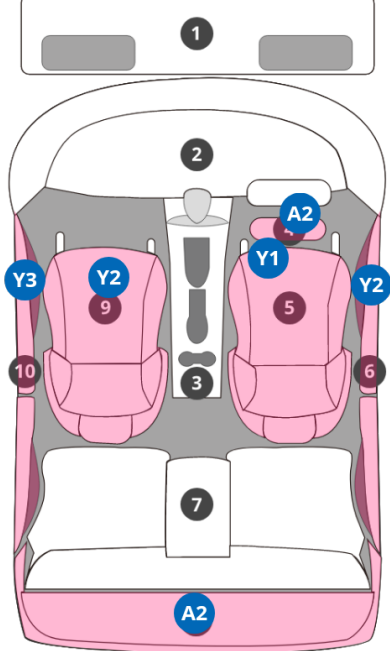
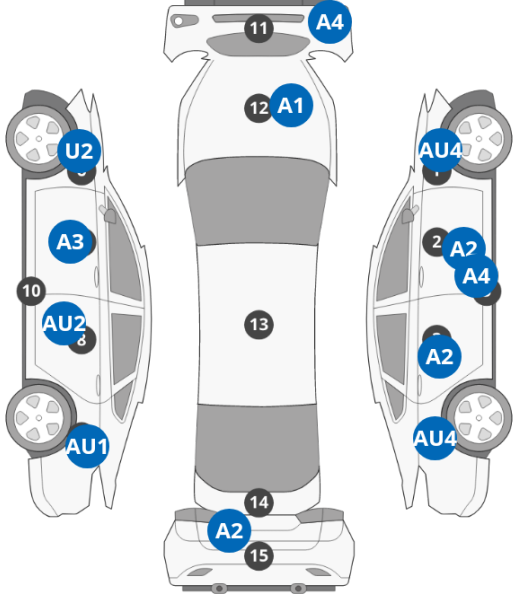
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	118	116	114
2	Boot Lid	96.3	98	92	99
3	Roof	102.0	114	103	96/96
4	Left Front Fender	102.9	98	102	109
5	Left Front Door	107.0	108	108	105
6	Center Panel Left				
7	Left Rear Door	102.8	112	103	94
8	Left Back Panel	109.8	122	113	94
9	Right Front Fender	110.3	112	104	115
10	Right Front Door	84.3	83	86	84
11	Center Panel Right				
12	Right Rear Door	85.4	90	78	88
13	Right Back Panel	95.7	94	87	107

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Minimal / (R) Front Trim - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Medium	Remarks (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with spare tire/with jack and tools/No LTO plate/No warranty booklet