

General Information

Date & Time: 10, Apr, 2025 13:09

Make	Toyota	Model	Veloz
YOM	2024	Mileage	20,549
Registration No.	NHR5561	Chassis No.	MHFAB1AYXP3071050
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



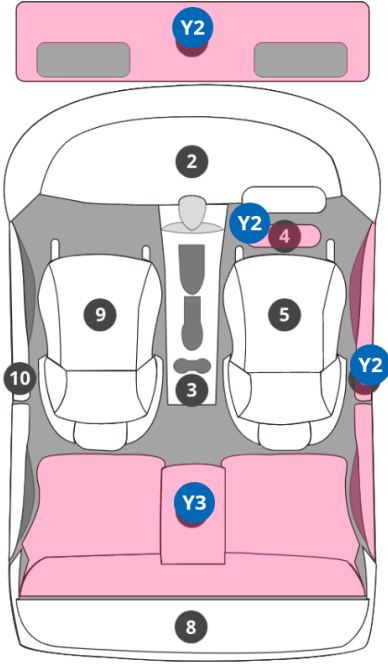
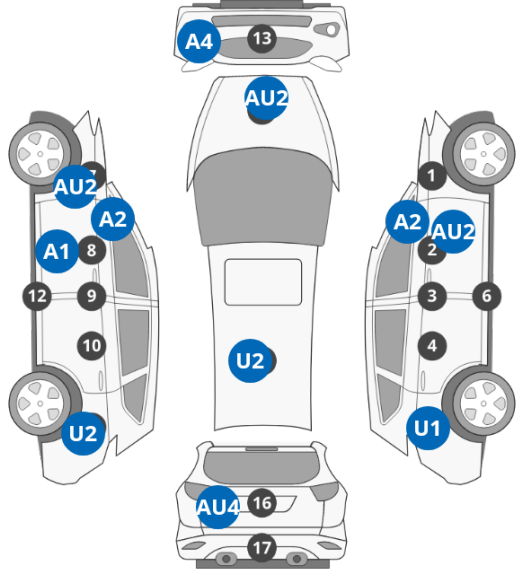
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.2	100	93	105
2	Boot Lid	103.9	107	111	94
3	Roof	111.2	118	120	102/105
4	Left Front Fender	101.6	107	98	100
5	Left Front Door	113.3	108	110	122
6	Center Panel Left				
7	Left Rear Door	108.6	111	107	108
8	Left Back Panel	112.0	116	111	109
9	Right Front Fender	98.1	99	103	93
10	Right Front Door	111.0	111	113	109
11	Center Panel Right				
12	Right Rear Door	108.0	107	106	111
13	Right Back Panel	116.6	104	113	133

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / Ceiling - Grime - Small / (L) Front Floor Mat - Grime - Small	Remarks Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Small / (L) Rear Fender, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Dent - Minimal / (R) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
Without warranty booklet. With Spare tire, jack and incomplete tools. With LTO plate.