

## General Information

Date & Time: 21, Apr, 2025 15:38

|                  |                   |              |                   |
|------------------|-------------------|--------------|-------------------|
| Make             | Toyota            | Model        | Vios              |
| YOM              | 2024              | Mileage      | 23,636            |
| Registration No. | NHR6734           | Chassis No.  | PA1B18F33P4230211 |
| CC               | 1.3               | Transmission | CVT               |
| Fuel Type        | Gas               | Type of Body | Sedan             |
| Colour           | Red Mica Metallic |              |                   |

## Body / Panel Condition



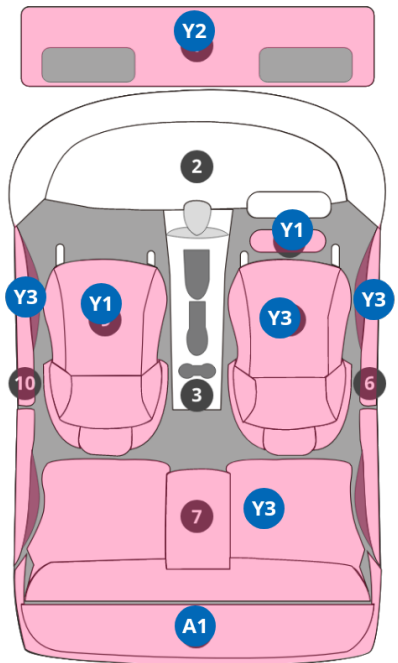
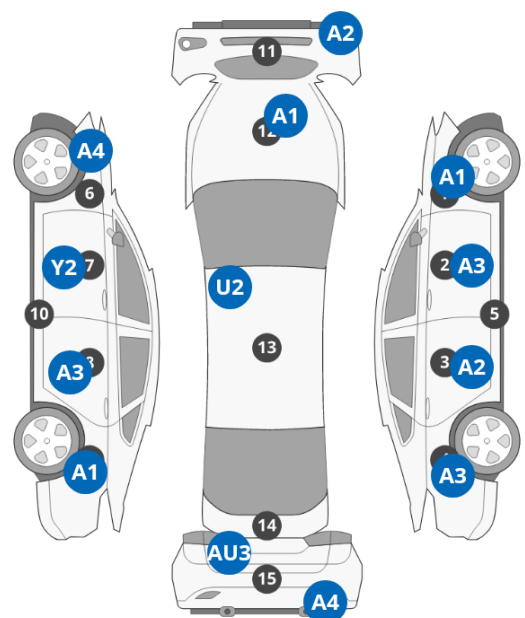
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 99.2          | 96     | 103    | 98       |
| 2  | Boot Lid           | 98.2          | 94     | 100    | 101      |
| 3  | Roof               | 90.0          | 91     | 91     | 88/91    |
| 4  | Left Front Fender  | 86.3          | 83     | 86     | 90       |
| 5  | Left Front Door    | 88.6          | 89     | 88     | 89       |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 90.6          | 99     | 89     | 85       |
| 8  | Left Back Panel    | 95.2          | 105    | 89     | 92       |
| 9  | Right Front Fender | 93.0          | 94     | 89     | 96       |
| 10 | Right Front Door   | 91.7          | 92     | 95     | 88       |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 91.6          | 88     | 88     | 99       |
| 13 | Right Back Panel   | 93.3          | 85     | 91     | 104      |

## Overall Evaluation :

C

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

| Interior Evaluation : <span style="color: red;">C</span>                                                                                                                                                                                                                                                   | Exterior Evaluation : <span style="color: red;">E</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>                                                         |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                      |
| <b>Remarks</b><br>(L) Front Floor Mat - Grime - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Medium / Ceiling - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Minimal | <b>Remarks</b><br>Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Crack, Gap - Small / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Dent - Small / Bonnet, Headlight - Scratch - Minimal |
| Frame Evaluation : <span style="color: red;">A</span>                                                                                                                                                                                                                                                      | Functional Evaluation : <span style="color: red;">B</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |
| <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                                                                        | <b>Remarks</b><br>Battery - Weak - Yes / Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |

## Inspector Notes

with LTO plate/with spare tire/with jack and incomplete tools/No reverse camera/trunk room cover missing/front left side trim door has small crack/possible flooding