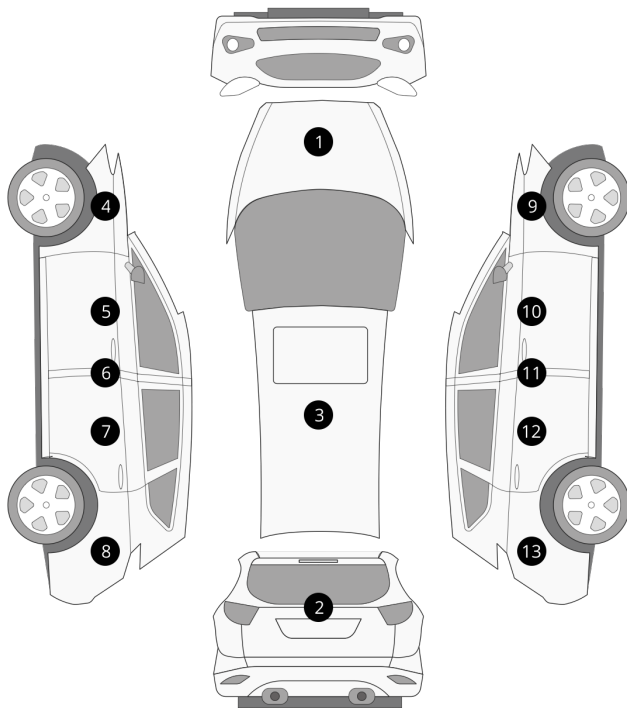


General Information

Date & Time: 14, Apr, 2025 09:00

Make	Toyota	Model	Vios
YOM	2024	Mileage	21,789
Registration No.	NHS1110	Chassis No.	PA1B18F36P4234009
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



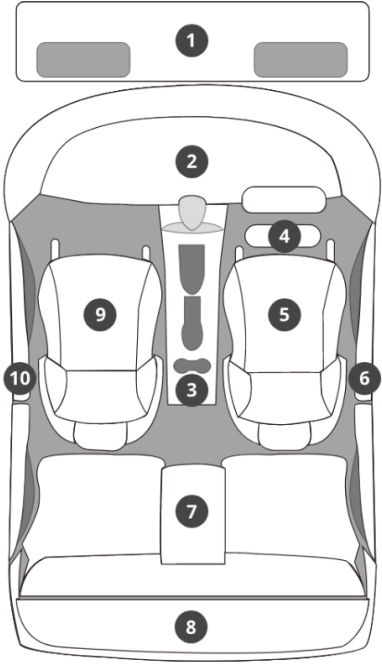
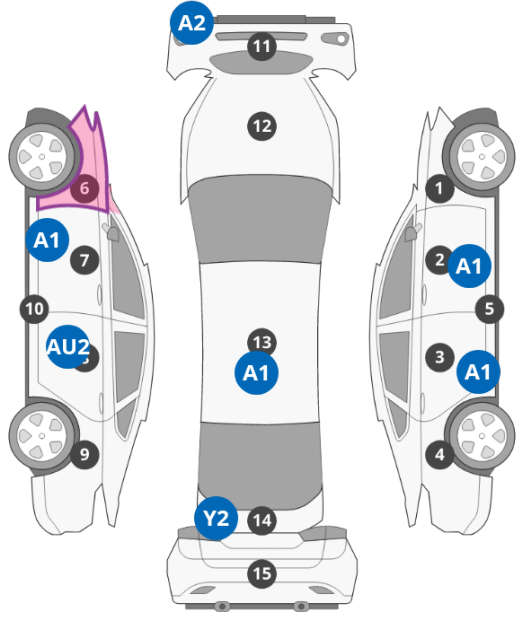
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	151.3	160	143	151
2	Boot Lid	146.6	139	154	147
3	Roof	147.7	151	149	141/150
4	Left Front Fender	137.6	141	137	135
5	Left Front Door	143.0	144	145	140
6	Center Panel Left				
7	Left Rear Door	141.0	150	139	134
8	Left Back Panel	147.0	154	144	143
9	Right Front Fender	143.0	139	142	148
10	Right Front Door	139.3	140	137	141
11	Center Panel Right				
12	Right Rear Door	146.3	141	143	155
13	Right Back Panel	149.3	148	147	153

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks (L) Front Wheel, Cover - Cap Missing - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Crack, Gap - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

missing front left wheel cap/ with LTO plate and warranty booklet/ with tools and jack/with spare tire / no horn