

General Information

Date & Time: 10, Apr, 2025 14:00

Make	Toyota	Model	Vios
YOM	2024	Mileage	21,619
Registration No.	NIU3805	Chassis No.	PA1B18F35R4243870
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



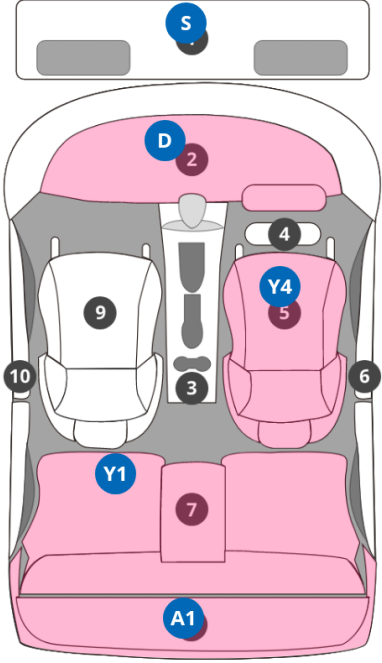
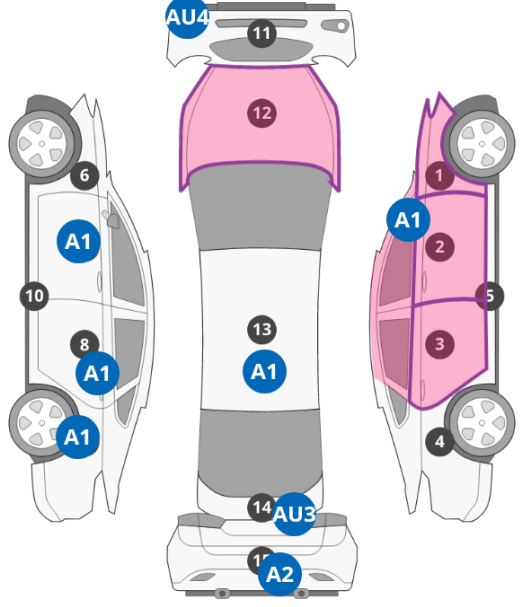
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	220.0	235	230	195
2	Boot Lid	120.6	117	127	118
3	Roof	98.9	101	109	90/96
4	Left Front Fender	96.8	98	100	93
5	Left Front Door	97.8	98	99	97
6	Center Panel Left				
7	Left Rear Door	95.6	99	96	92
8	Left Back Panel	100.6	105	100	97
9	Right Front Fender	241.6	237	265	223
10	Right Front Door	188.6	215	151	200
11	Center Panel Right				
12	Right Rear Door	138.6	130	131	155
13	Right Back Panel	104.5	95	98	121

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / Rear Seat - Grime - Minimal / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Smell - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with jack and incomplete tools/No warranty booklet/ No reverse camera/glove box issue