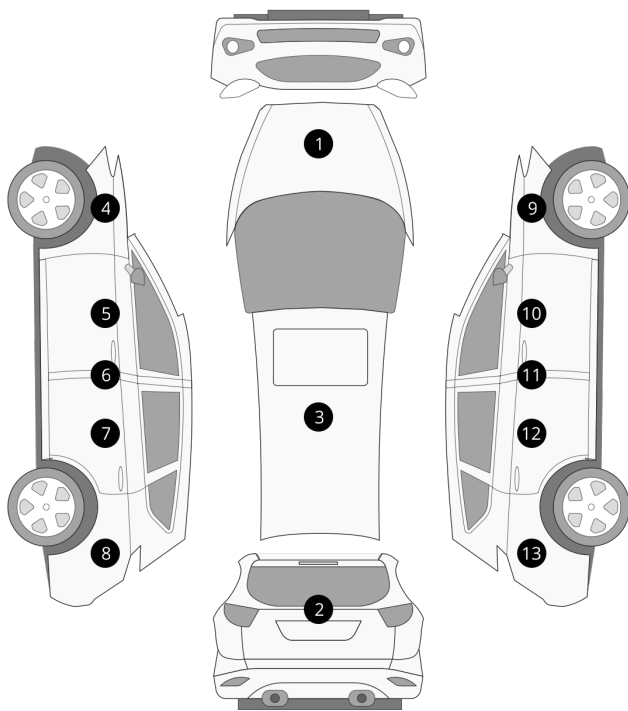


General Information

Date & Time: 21, Apr, 2025 17:26

Make	Toyota	Model	Wigo
YOM	2020	Mileage	43,750
Registration No.	NGL1674	Chassis No.	MHKA4DE5EKJD38613
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Black		

Body / Panel Condition



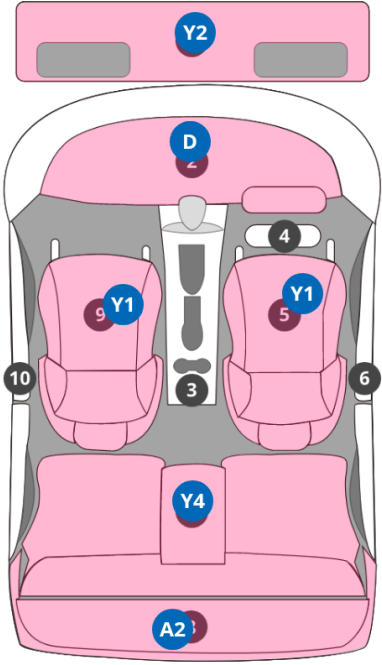
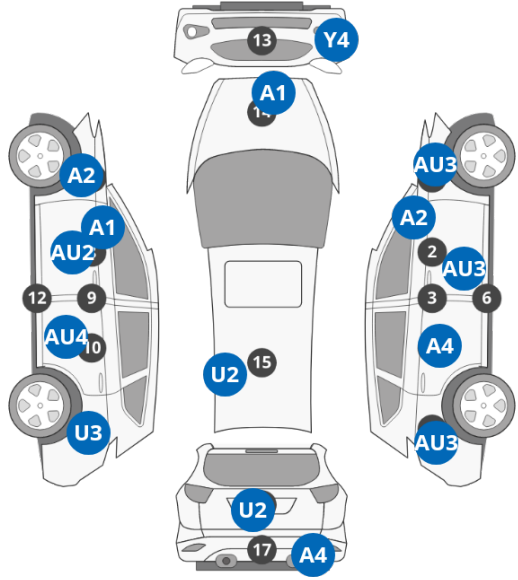
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	82.0	77	87	82
2	Boot Lid	95.8	92	104	92
3	Roof	69.7	63	74	70/72
4	Left Front Fender	84.4	75	92	87
5	Left Front Door	93.4	93	97	90
6	Center Panel Left				
7	Left Rear Door	94.1	90	92	100
8	Left Back Panel	89.9	102	90	77
9	Right Front Fender	91.4	92	95	88
10	Right Front Door	88.9	87	93	86
11	Center Panel Right				
12	Right Rear Door	92.0	98	92	86
13	Right Back Panel	95.7	94	90	104

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Large / (R) Front Seat - Grime - Minimal / Trunk Room - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / (L) Front Seat - Grime - Minimal	Remarks (L) Rear Fender, Molding - Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/with spare tire/with jack and incomplete tools/with warranty booklet/No reverse camera/plate light issue/ no VS form