

General Information

Date & Time: 10, Apr, 2025 10:57

Make	Toyota	Model	Vios
YOM	2023	Mileage	20,528
Registration No.	NIG3842	Chassis No.	PA1B18F3XN4198435
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



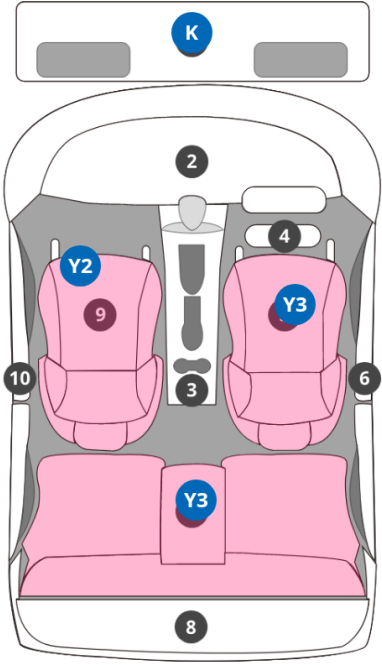
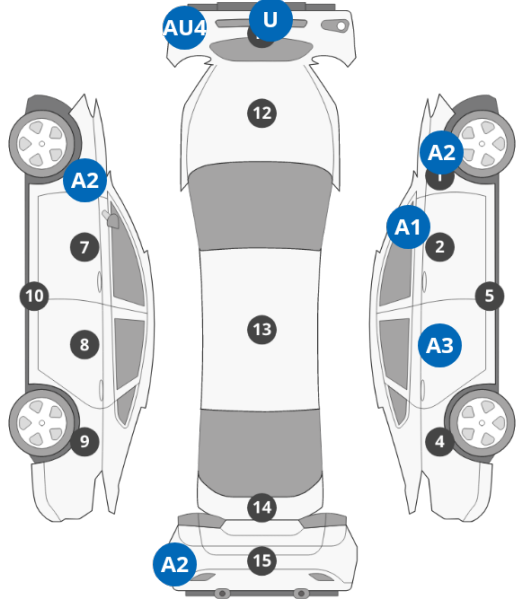
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.3	111	115	114
2	Boot Lid	103.8	103	100	109
3	Roof	92.0	89	89	93/97
4	Left Front Fender	268.0	270	259	275
5	Left Front Door	96.1	101	97	91
6	Center Panel Left				
7	Left Rear Door	98.9	99	99	99
8	Left Back Panel	105.1	111	99	105
9	Right Front Fender	100.4	100	103	99
10	Right Front Door	103.0	103	105	101
11	Center Panel Right				
12	Right Rear Door	100.8	101	99	103
13	Right Back Panel	105.6	106	102	109

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Overall Interior - Animal Hair - Yes / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small	Remarks (L) Front Fender - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (R) Rear Door, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

Without warranty booklet, spare tire and tools. With jack. With LTO plate.