

## General Information

Date & Time: 14, Apr, 2025 13:54

|                  |          |              |                   |
|------------------|----------|--------------|-------------------|
| Make             | Lexus    | Model        | RZ450E            |
| YOM              | 2024     | Mileage      | 559               |
| Registration No. | DBV1078  | Chassis No.  | JTJAAAAB1PA019567 |
| CC               | N/A      | Transmission | BEV               |
| Fuel Type        | Electric | Type of Body | SUV               |
| Colour           | Brown    |              |                   |

## Body / Panel Condition



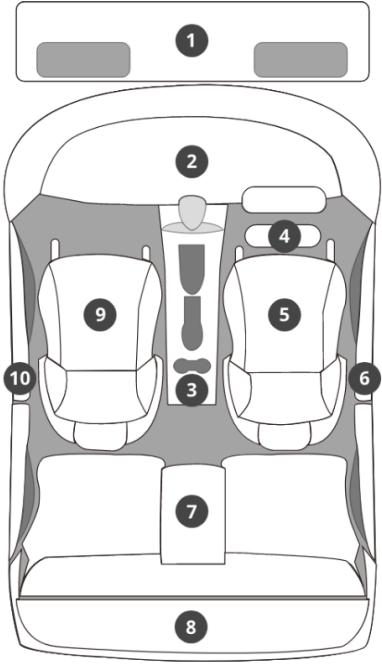
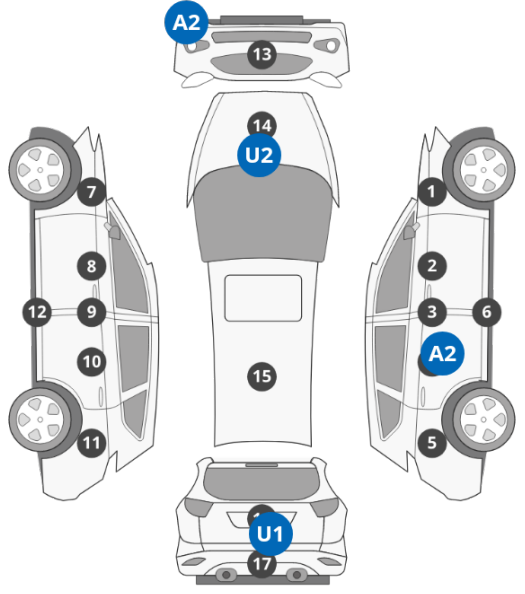
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 115.3         | 110    | 126    | 110      |
| 2  | Boot Lid           | 149.0         | 139    | 160    | 148      |
| 3  | Roof               | 154.0         | 154    | 157    | 141/164  |
| 4  | Left Front Fender  | 157.0         | 156    | 163    | 152      |
| 5  | Left Front Door    | 155.6         | 161    | 167    | 139      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 151.3         | 151    | 154    | 149      |
| 8  | Left Back Panel    | 161.0         | 161    | 162    | 160      |
| 9  | Right Front Fender | 156.3         | 163    | 135    | 171      |
| 10 | Right Front Door   | 156.3         | 146    | 158    | 165      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 161.0         | 167    | 163    | 153      |
| 13 | Right Back Panel   | 163.6         | 161    | 156    | 174      |

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

| Interior Evaluation : <span style="color: red; font-weight: bold;">A</span>                                                                                                                                                                        | Exterior Evaluation : <span style="color: red; font-weight: bold;">A</span>                                                                                                                                                                                                                                                             |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p> |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p> |
| <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                | <b>Remarks</b><br>(R) Rear Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Trunk Hood, Rear Gate - Dent - Minimal / Bonnet, Headlight - Dent - Small                                                                                                                                                  |
| Frame Evaluation : <span style="color: red; font-weight: bold;">A</span>                                                                                                                                                                           | Functional Evaluation : <span style="color: red; font-weight: bold;">A</span>                                                                                                                                                                                                                                                           |
| <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                | <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                                                                                                     |

| Inspector Notes                                                                         |
|-----------------------------------------------------------------------------------------|
| no warranty booklet/ with spare tire and tools/ no jack / with LTO plate/ with charger/ |