

## General Information

Date & Time: 21, Apr, 2025 18:56

|                  |                   |              |                   |
|------------------|-------------------|--------------|-------------------|
| Make             | Toyota            | Model        | Veloz             |
| YOM              | 2023              | Mileage      | 20,658            |
| Registration No. | NHJ8066           | Chassis No.  | MHFAB1BY9P3058855 |
| CC               | 1.5               | Transmission | CVT               |
| Fuel Type        | Gas               | Type of Body | Sedan             |
| Colour           | Red Mica Metallic |              |                   |

## Body / Panel Condition



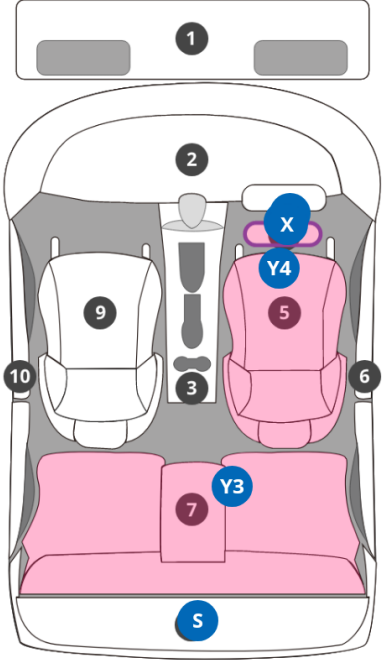
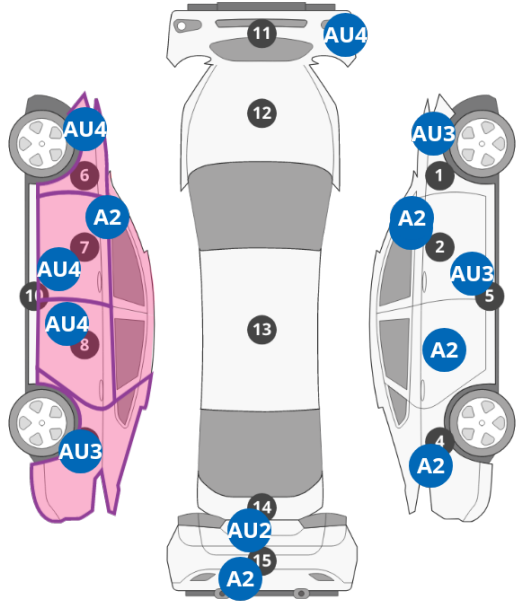
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 94.4          | 97     | 90     | 97       |
| 2  | Boot Lid           | 87.8          | 87     | 97     | 80       |
| 3  | Roof               | 97.6          | 107    | 106    | 89/89    |
| 4  | Left Front Fender  | 89.3          | 87     | 90     | 92       |
| 5  | Left Front Door    | 86.5          | 82     | 86     | 92       |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 95.8          | 106    | 88     | 94       |
| 8  | Left Back Panel    | 107.1         | 109    | 98     | 115      |
| 9  | Right Front Fender | 91.1          | 100    | 90     | 84       |
| 10 | Right Front Door   | 93.9          | 100    | 89     | 93       |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 95.8          | 94     | 89     | 105      |
| 13 | Right Back Panel   | 108.6         | 101    | 105    | 120      |

## Overall Evaluation :

C

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

|                                                                                                                                                                                                                                                    |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Interior Evaluation :</b> <span style="color: red; font-weight: bold;">C</span>                                                                                                                                                                 | <b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold;">E</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p> |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
| <p><b>Remarks</b></p> <p>Rear Seat - Grime - Medium / Overall Interior - Smell - Yes / (R) Front Seat - Grime - Large / Mat Other - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes</p>                  | <p><b>Remarks</b></p> <p>(R) Front Fender, Molding - Scratch &amp; Dent - Medium / (R) Mirror - Faded(Color, Gloss) - Yes / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch &amp; Dent - Large / (L) Front Door, Molding - Scratch &amp; Dent - Large / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch &amp; Dent - Large / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large</p> |
| <b>Frame Evaluation :</b> <span style="color: red; font-weight: bold;">A</span>                                                                                                                                                                    | <b>Functional Evaluation :</b> <span style="color: red; font-weight: bold;">B</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |
| <p><b>Remarks</b></p> <p>Defects not found</p>                                                                                                                                                                                                     | <p><b>Remarks</b></p> <p>Retractable Mirror - Issue - Yes</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |

|                                                                                                                                                       |
|-------------------------------------------------------------------------------------------------------------------------------------------------------|
| <p><b>Inspector Notes</b></p>                                                                                                                         |
| <p>with warranty booklet, with jack and tools, with spare tire, with LTO plate, retractable mirror issue, possible flooding, all floormat missing</p> |