


General Information

Date & Time: 28, Apr, 2025 09:45

Make	Toyota	Model	Vios
YOM	2024	Mileage	5,247
Registration No.	NFR6754	Chassis No.	PA1B18F35R4257302
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition

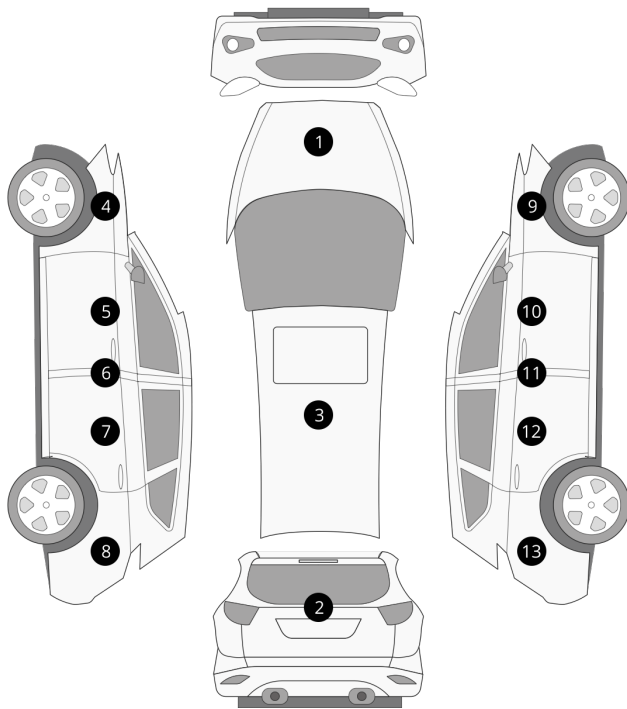

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	89.5	91	87	91
2	Boot Lid	72.4	85	77	55
3	Roof	86.8	92	84	85/87
4	Left Front Fender	84.3	85	85	83
5	Left Front Door	88.9	97	88	82
6	Center Panel Left				
7	Left Rear Door	82.8	86	81	82
8	Left Back Panel	120.3	114	108	139
9	Right Front Fender	85.4	92	80	85
10	Right Front Door	84.7	87	80	87
11	Center Panel Right				
12	Right Rear Door	89.1	90	85	93
13	Right Back Panel	215.0	382	148	115

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
Diagram of car interior showing seats, dashboard, and floor mats. Callouts include: 1 (Rear View Mirror), 2 (Rear Headrest), 3 (Center Console), 4 (Front Passenger Seat), 5 (Front Driver Seat), 6 (Front Passenger Side Trim), 7 (Front Center Console), 8 (Front Floor Mat), 9 (Front Passenger Side Trim), 10 (Front Driver Side Trim). Lettered callouts: A1 (Front Passenger Side Trim), Y1 (Front Passenger Side Trim), Y3 (Front Passenger Side Trim, Front Driver Seat, Front Center Console).	Diagram of car exterior showing front, side, and rear views. Callouts include: 1 (Front Right Headlight), 2 (Front Right Bumper), 3 (Front Right Door), 4 (Front Right Wheel), 5 (Front Right Side Trim), 6 (Front Right Side Trim), 7 (Front Right Side Trim), 8 (Front Right Side Trim), 9 (Front Right Side Trim), 10 (Front Right Side Trim), 11 (Front Right Side Trim), 12 (Front Right Side Trim), 13 (Front Right Side Trim), 14 (Front Right Side Trim), 15 (Front Right Side Trim). Lettered callouts: A1 (Front Right Side Trim), A2 (Front Right Side Trim), A3 (Front Right Side Trim), A4 (Front Right Side Trim), AU3 (Front Right Side Trim), Y3 (Front Right Side Trim).
Remarks Rear Seat - Grime - Medium / (R) Rear Trim - Cut, Crack - Minimal / (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Grime - Medium	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Rear End Panel - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (L) Rear Fender, Molding - Repair mark - Yes / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Roof - Scratch - Small
Frame Evaluation : D	Functional Evaluation : A
Remarks Rear Side Member & Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes	Remarks Defects not found

Inspector Notes

with warranty booklet, no jack, no tools, with spare tire, with LTO plate
