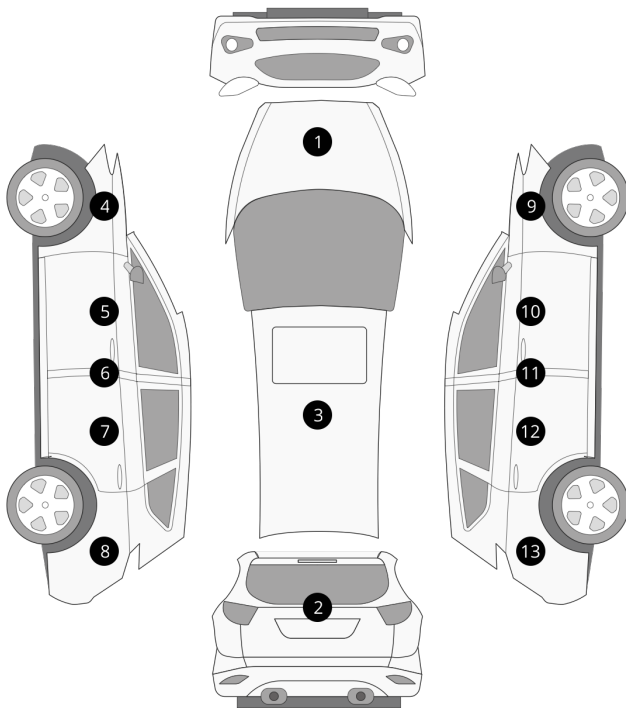


General Information

Date & Time: 28, Apr, 2025 08:55

Make	Toyota	Model	Vios
YOM	2025	Mileage	17,950
Registration No.	DBP6491	Chassis No.	PA1B18F34R4262460
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



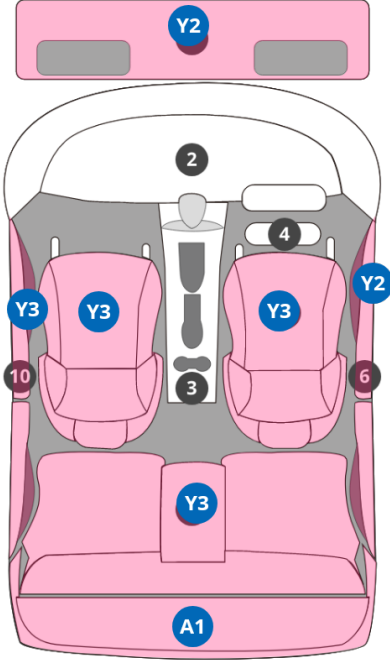
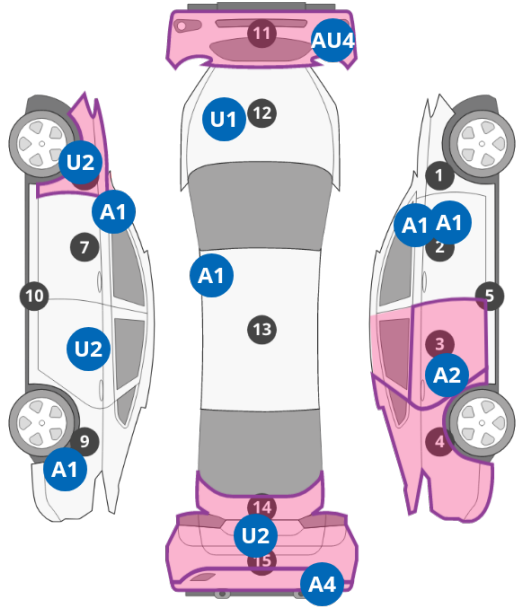
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.1	100	99	101
2	Boot Lid	93.3	93	90	97
3	Roof	87.3	97	84	87/82
4	Left Front Fender	92.6	90	90	98
5	Left Front Door	93.5	94	95	92
6	Center Panel Left				
7	Left Rear Door	90.4	94	89	88
8	Left Back Panel	97.8	106	94	94
9	Right Front Fender	85.8	90	70	98
10	Right Front Door	89.5	89	85	96
11	Center Panel Right				
12	Right Rear Door	90.0	88	85	97
13	Right Back Panel	89.1	83	90	95

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / Ceiling - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Minimal	Remarks (R) Rear Door, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Door, Molding - Dent - Small / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Bonnet, Headlight - Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with warranty booklet/No jack and tools/left side tail light scratch