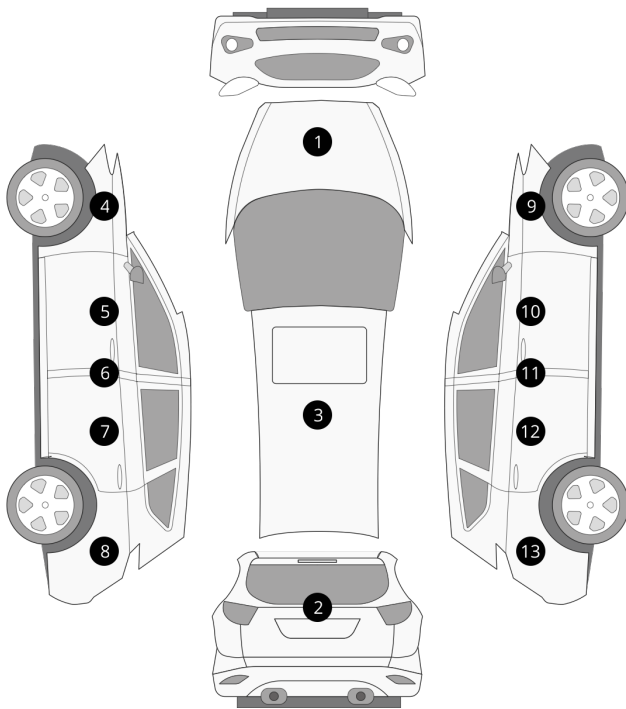


General Information

Date & Time: 29, Apr, 2025 10:24

Make	Toyota	Model	Vios
YOM	2024	Mileage	7,756
Registration No.	DBP2915	Chassis No.	PA1B18F32R4260738
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



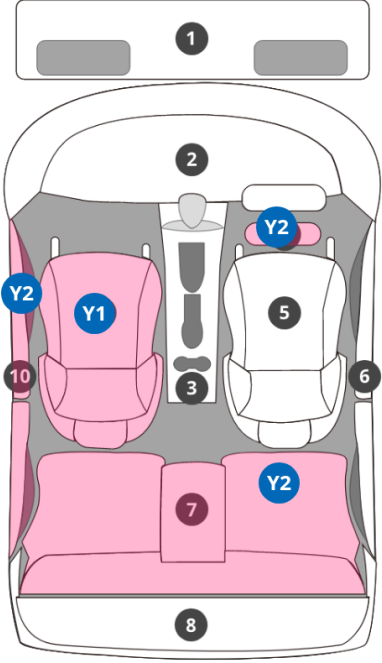
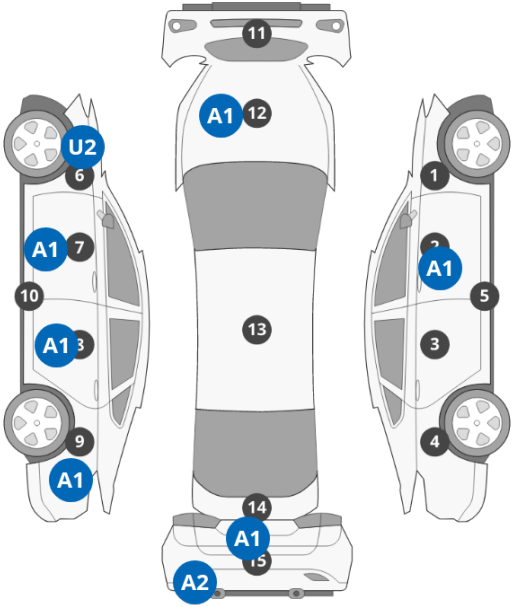
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	96.4	100	94	95
2	Boot Lid	95.6	93	97	98
3	Roof	86.3	93	86	80/85
4	Left Front Fender	88.8	88	90	88
5	Left Front Door	86.5	92	89	79
6	Center Panel Left				
7	Left Rear Door	91.5	96	89	90
8	Left Back Panel	96.6	101	97	93
9	Right Front Fender	88.9	89	88	90
10	Right Front Door	87.0	89	86	86
11	Center Panel Right				
12	Right Rear Door	84.7	86	85	83
13	Right Back Panel	85.4	79	85	92

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : A
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small / (L) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Small	Remarks Bonnet, Headlight - Scratch - Minimal / (L) Front Fender, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate/with spare tire/with jack and incomplete tools/with warranty booklet/dome light issue