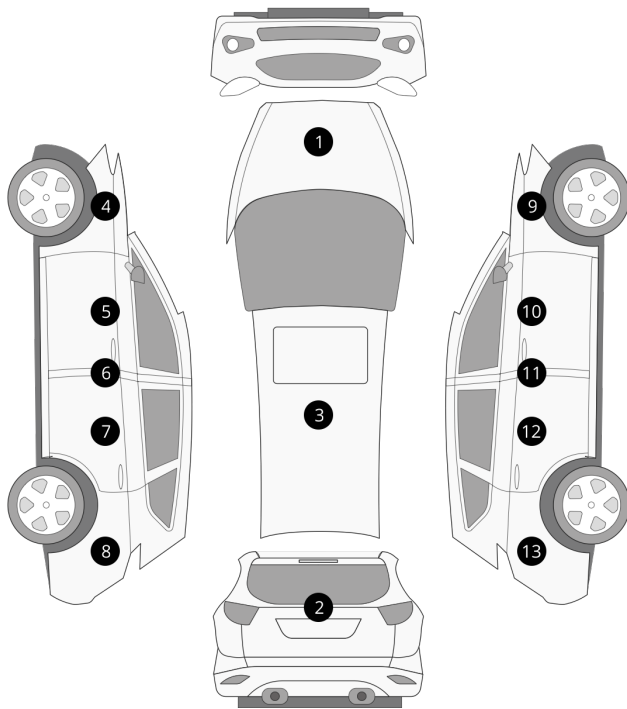


General Information

Date & Time: 28, Apr, 2025 16:41

Make	Toyota	Model	Vios
YOM	2024	Mileage	18,168
Registration No.	DBO7653	Chassis No.	PA1B18F36R4256482
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



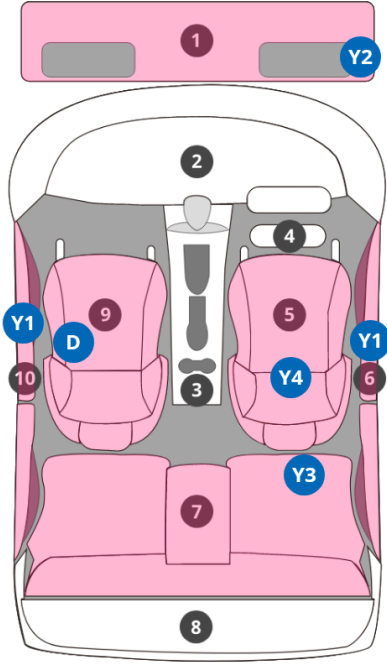
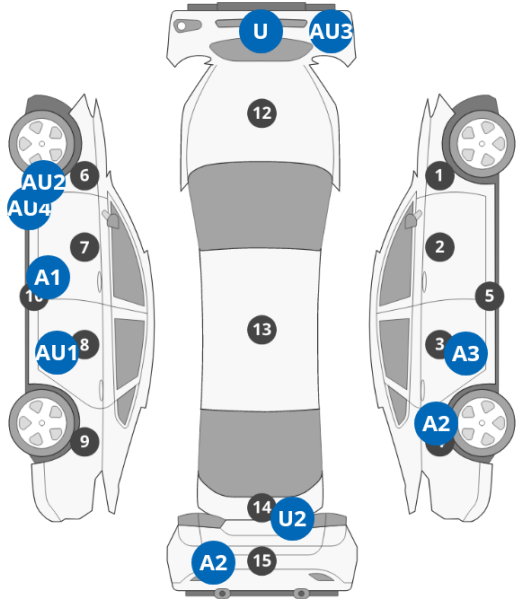
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.8	101	94	99
2	Boot Lid	97.5	99	99	96
3	Roof	93.0	100	93	89/91
4	Left Front Fender	85.3	86	88	83
5	Left Front Door	91.6	92	89	94
6	Center Panel Left				
7	Left Rear Door	97.4	100	101	91
8	Left Back Panel	91.5	95	93	87
9	Right Front Fender	86.8	83	87	91
10	Right Front Door	87.6	90	86	87
11	Center Panel Right				
12	Right Rear Door	94.8	91	89	105
13	Right Back Panel	99.8	98	95	106

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / Ceiling - Grime - Small	Remarks (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, with jack, no tools, with spare tire, with LTO plate, scratches on tail light j