

General Information

Date & Time: 28, Apr, 2025 13:14

Make	Toyota	Model	Vios
YOM	2023	Mileage	73,069
Registration No.	DBI4602	Chassis No.	PA1B18F34P4215183
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



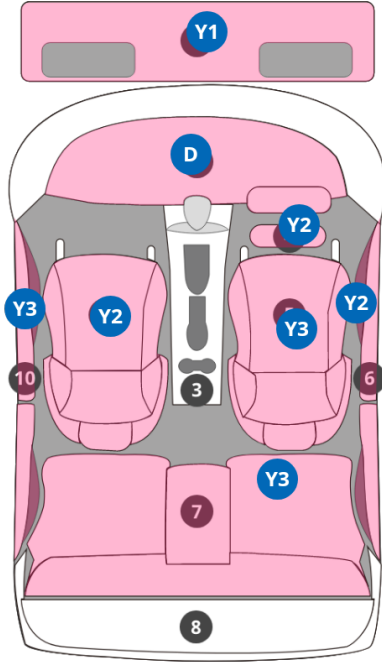
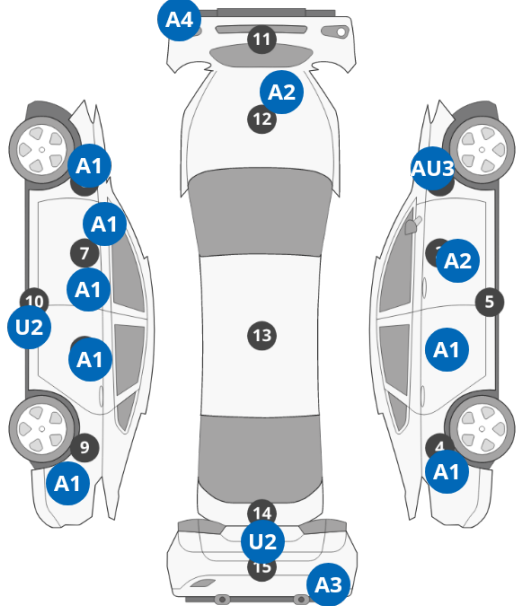
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.0	102	103	104
2	Boot Lid	120.2	95	100	166
3	Roof	90.3	94	82	96/90
4	Left Front Fender	90.3	93	90	88
5	Left Front Door	87.8	90	86	88
6	Center Panel Left				
7	Left Rear Door	96.3	103	91	95
8	Left Back Panel	103.6	115	93	103
9	Right Front Fender	87.8	89	89	86
10	Right Front Door	90.8	92	87	94
11	Center Panel Right				
12	Right Rear Door	97.4	90	91	112
13	Right Back Panel	90.6	82	89	101

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Minimal	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/with warranty booklet/No spare tire/No jack/No tools/No reverse camera/plate light issue