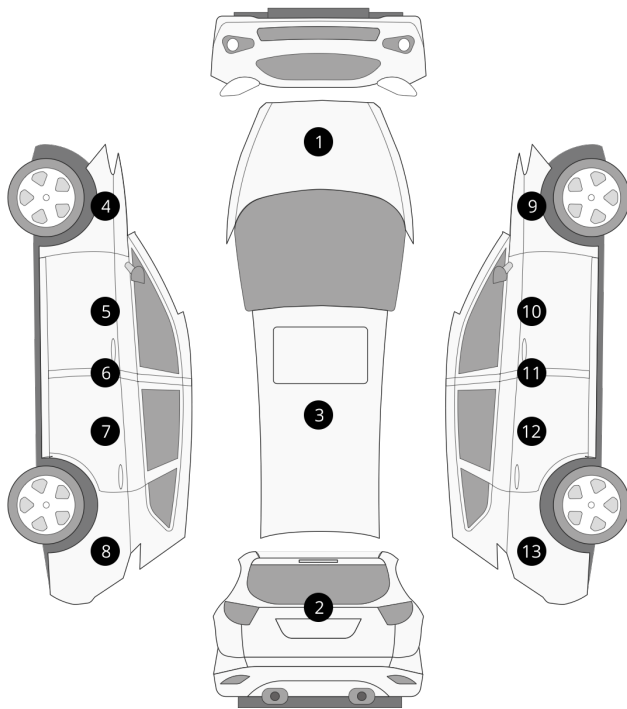


General Information

Date & Time: 28, Apr, 2025 09:54

Make	Toyota	Model	Vios
YOM	2021	Mileage	59,540
Registration No.	CAW3096	Chassis No.	PA1B18F33M4157532
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



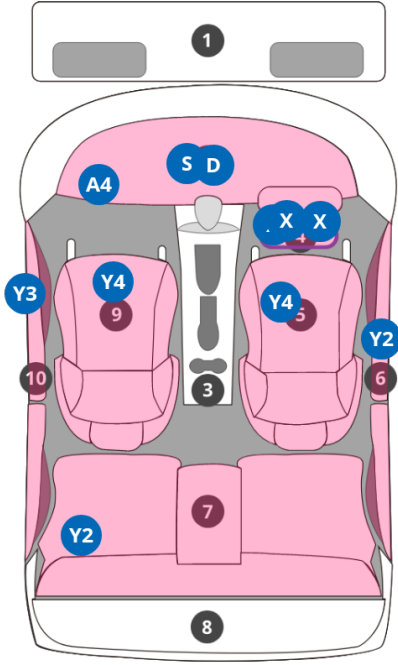
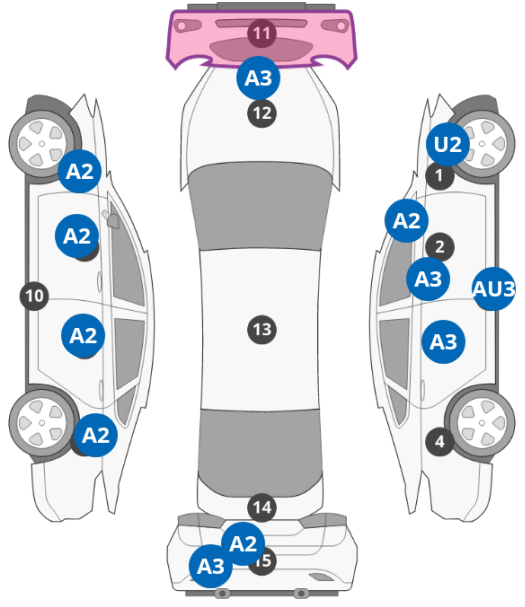
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.8	94	92	101
2	Boot Lid	95.1	88	98	100
3	Roof	82.3	92	75	79/83
4	Left Front Fender	82.6	88	87	73
5	Left Front Door	84.1	84	90	79
6	Center Panel Left				
7	Left Rear Door	82.7	82	81	85
8	Left Back Panel	94.0	96	92	95
9	Right Front Fender	77.5	73	81	79
10	Right Front Door	80.3	79	81	81
11	Center Panel Right				
12	Right Rear Door	86.1	90	83	86
13	Right Back Panel	92.6	84	97	98

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Steering Wheel - Worn, Peel, Crack - Large / (L) Front Seat - Grime - Large / (R) Front Seat - Grime - Large / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / Overall Interior - Smell - Yes	Remarks (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / (R) Front Fender, Molding - Dent - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / Bonnet, Headlight - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet/ no jack and tool/ possible flooding/ no spare tire/ with LTO plate