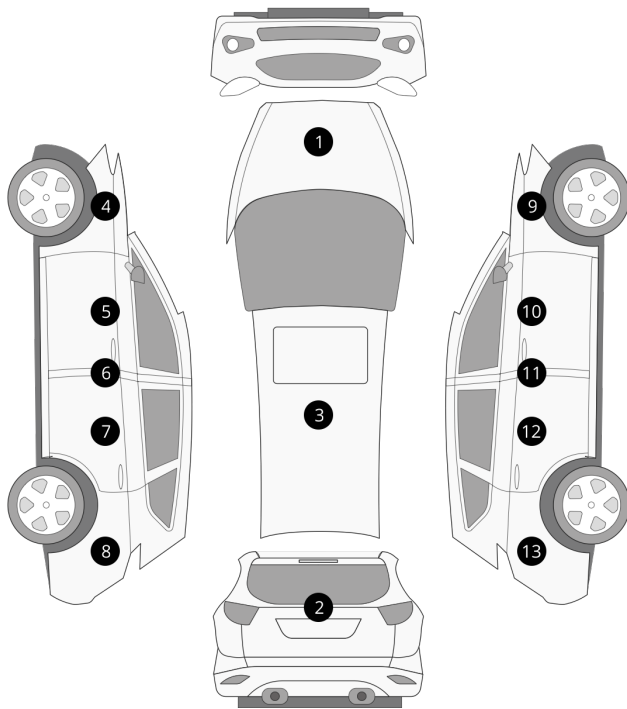


General Information

Date & Time: 30, Apr, 2025 08:20

Make	Toyota	Model	Vios
YOM	2022	Mileage	58,621
Registration No.	CBE1624	Chassis No.	PA1B18F3XN4188519
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



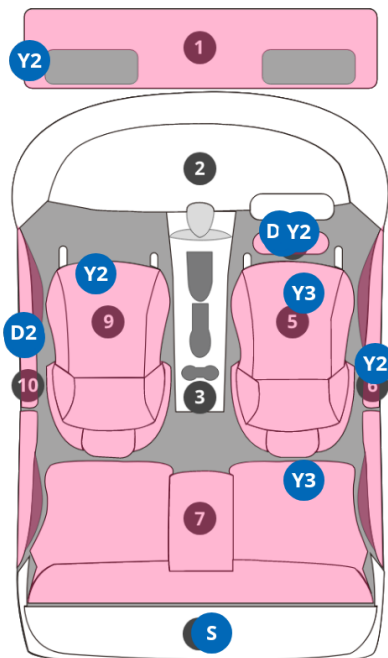
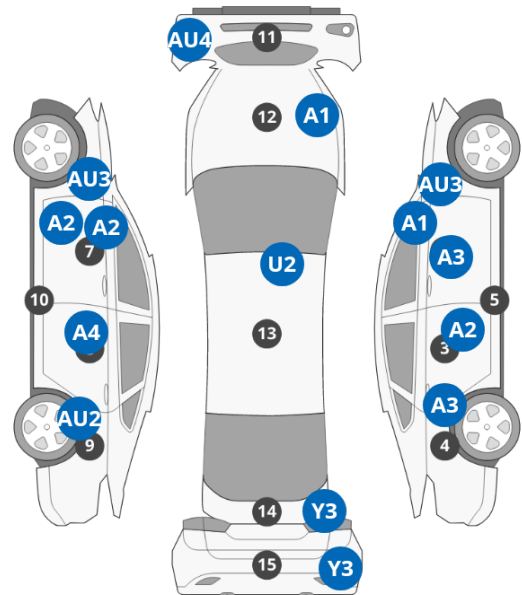
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.7	98	97	98
2	Boot Lid	93.5	92	95	94
3	Roof	90.9	97	77	101/89
4	Left Front Fender	87.3	86	85	91
5	Left Front Door	91.1	102	86	85
6	Center Panel Left				
7	Left Rear Door	82.5	87	84	77
8	Left Back Panel	95.3	102	92	93
9	Right Front Fender	81.6	79	85	81
10	Right Front Door	88.0	95	85	84
11	Center Panel Right				
12	Right Rear Door	85.8	79	82	96
13	Right Back Panel	85.6	84	81	92

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C		Exterior Evaluation : E	
			
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Small / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Worked - Large / (L) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Trim - Worked - Small / Overall Interior - Smell - Yes / Ceiling - Grime - Small		Remarks (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Crack, Gap - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal / Roof - Dent - Small	
Frame Evaluation : B		Functional Evaluation : A	
Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes		Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist	

Inspector Notes

no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light, possible flooding, worn tires