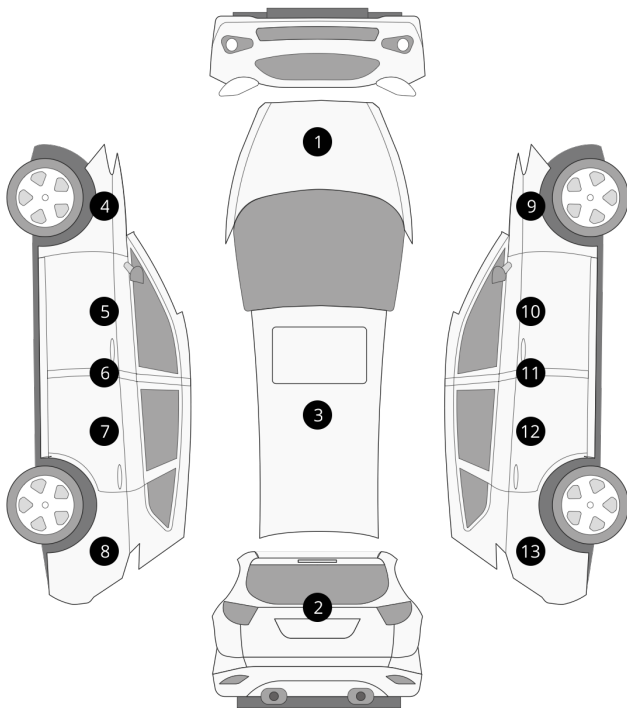


General Information

Date & Time: 23, Apr, 2025 08:43

Make	Toyota	Model	Vios
YOM	2021	Mileage	67,631
Registration No.	DBF2015	Chassis No.	PA1B18F35M4157466
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



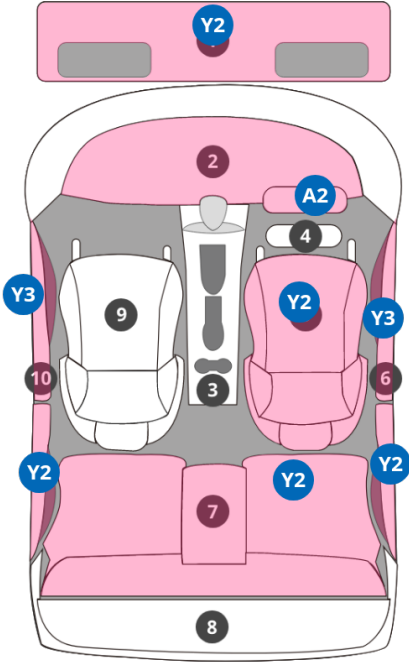
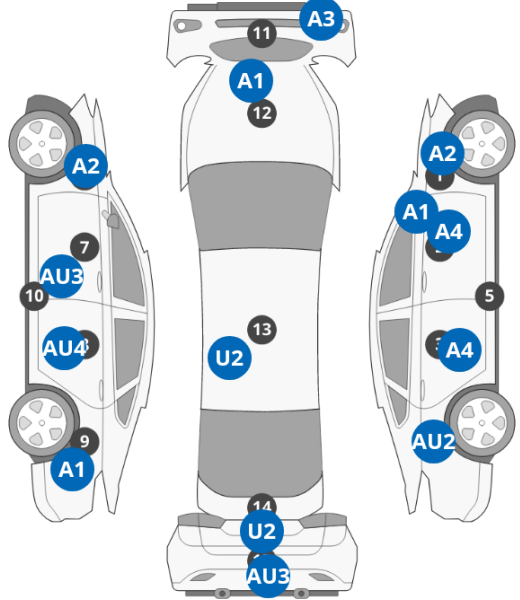
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.3	101	104	93
2	Boot Lid	100.8	102	100	101
3	Roof	79.5	82	73	81/82
4	Left Front Fender	82.3	83	80	84
5	Left Front Door	90.2	88	97	86
6	Center Panel Left				
7	Left Rear Door	135.0	141	135	129
8	Left Back Panel	94.5	95	95	94
9	Right Front Fender	83.8	85	88	79
10	Right Front Door	87.8	87	87	89
11	Center Panel Right				
12	Right Rear Door	87.3	86	84	92
13	Right Back Panel	86.8	87	83	91

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Medium / (L) Rear Trim - Grime - Small / Rear Seat - Grime - Small / (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Small / Steering Wheel - Worn, Peel, Crack - Small	Remarks (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Large / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with jack and tools/with warranty booklets/plate light issue/No reverse camera/possible flooding/trunk room no cover