

General Information

Date & Time: 28, Apr, 2025 14:36

Make	Toyota	Model	Vios
YOM	2023	Mileage	90,236
Registration No.	DBG7764	Chassis No.	PA1B18F37P4203397
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



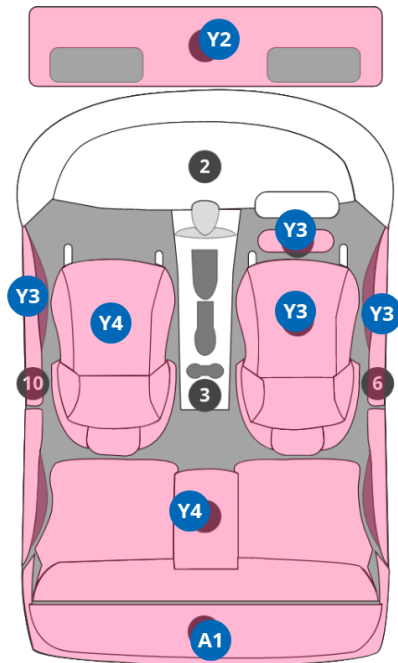
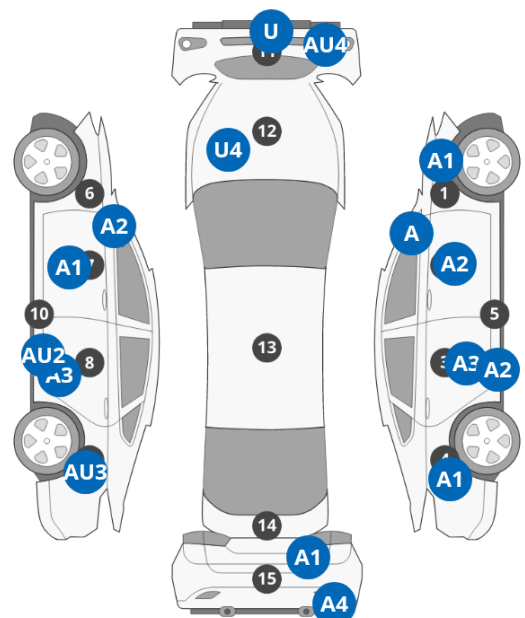
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.1	94	92	106
2	Boot Lid	91.9	87	96	93
3	Roof	86.4	91	79	94/82
4	Left Front Fender	86.3	85	86	88
5	Left Front Door	86.0	86	85	86
6	Center Panel Left				
7	Left Rear Door	89.9	94	88	88
8	Left Back Panel	93.1	94	94	92
9	Right Front Fender	88.3	90	91	85
10	Right Front Door	83.8	84	80	87
11	Center Panel Right				
12	Right Rear Door	88.8	84	86	96
13	Right Back Panel	90.2	86	86	99

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Large / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Ceiling - Grime - Small	Remarks Member (Bolted) - Dent - Yes / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Dent - Large / (L) Mirror - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Mirror - Scratch, Peeled - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate/incomplete tools/No reverse camera/plate light issue/park light issue/No jack/with tire No rim/right side mirror cover missing