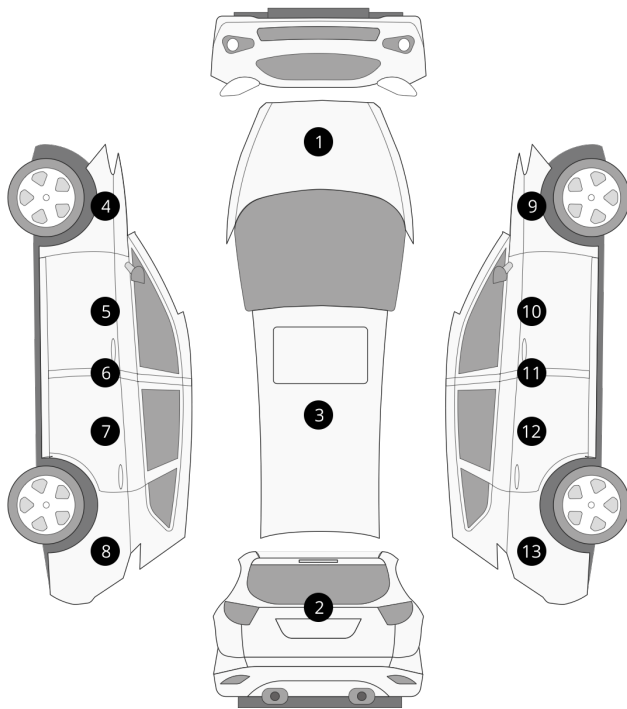


General Information

Date & Time: 30, Apr, 2025 08:20

Make	Toyota	Model	Vios
YOM	2020	Mileage	19,813
Registration No.	DBA8198	Chassis No.	PA1B18F36L4118030
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



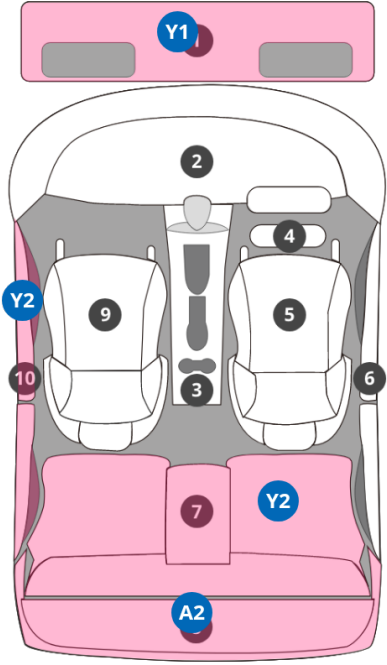
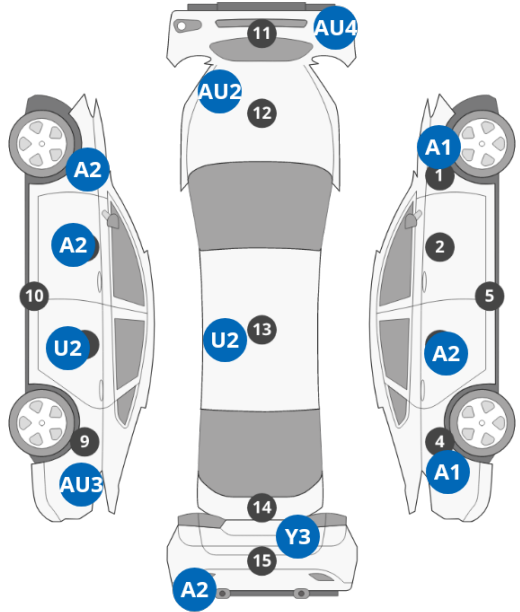
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	139.6	132	146	141
2	Boot Lid	402.6	193	608	407
3	Roof	80.0	87	74	84/75
4	Left Front Fender	81.7	80	80	85
5	Left Front Door	87.3	95	87	80
6	Center Panel Left				
7	Left Rear Door	93.2	100	91	89
8	Left Back Panel	88.3	93	87	85
9	Right Front Fender	84.3	88	82	83
10	Right Front Door	81.2	78	84	82
11	Center Panel Right				
12	Right Rear Door	81.7	79	82	85
13	Right Back Panel	148.3	155	141	149

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Minimal / (L) Front Trim - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Door, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Crack, Gap - Medium / Roof - Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes

Inspector Notes

with LTO plate/with spare tire/with warranty booklet/No jack and tools/possible flooding/right rear side tail light cover crack