

General Information

Date & Time: 28, Apr, 2025 08:44

Make	Toyota	Model	Vios
YOM	2023	Mileage	52,829
Registration No.	DBB5404	Chassis No.	PA1B18F30N4195706
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



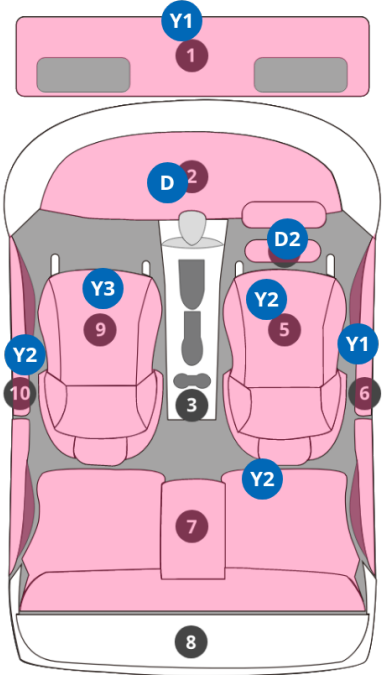
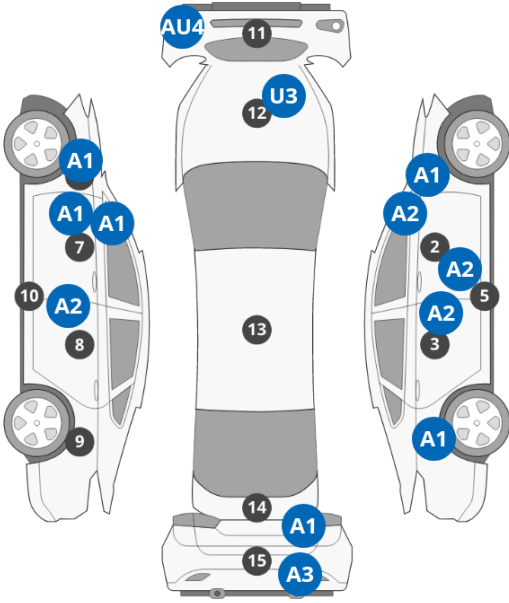
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.5	97	87	102
2	Boot Lid	178.0	179	148	207
3	Roof	84.2	87	82	86/82
4	Left Front Fender	85.5	87	86	84
5	Left Front Door	86.3	82	89	88
6	Center Panel Left				
7	Left Rear Door	86.8	90	86	85
8	Left Back Panel	91.7	102	84	89
9	Right Front Fender	88.3	84	96	86
10	Right Front Door	88.5	92	86	87
11	Center Panel Right				
12	Right Rear Door	81.0	74	77	93
13	Right Back Panel	85.2	86	80	90

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Minimal / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / Rear Seat - Grime - Small / (R) Front Trim - Grime - Minimal	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, with jack, incomplete tools, with spare tire, no LTO plate, plate light issue