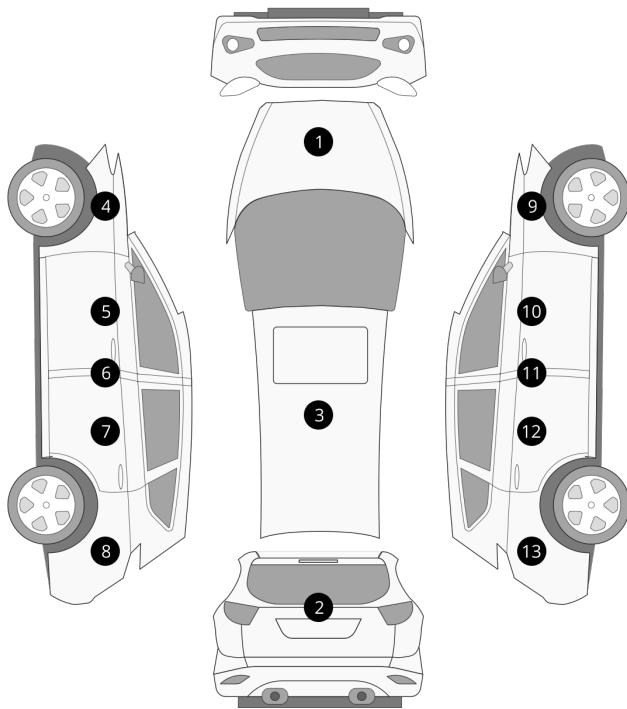


General Information

Date & Time: 25, Apr, 2025 14:04

Make	Toyota	Model	Vios
YOM	2024	Mileage	15,559
Registration No.	DBN1684	Chassis No.	PA1B18F33P4228877
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



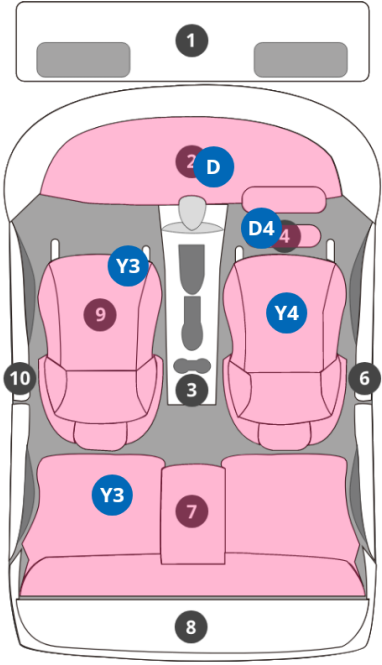
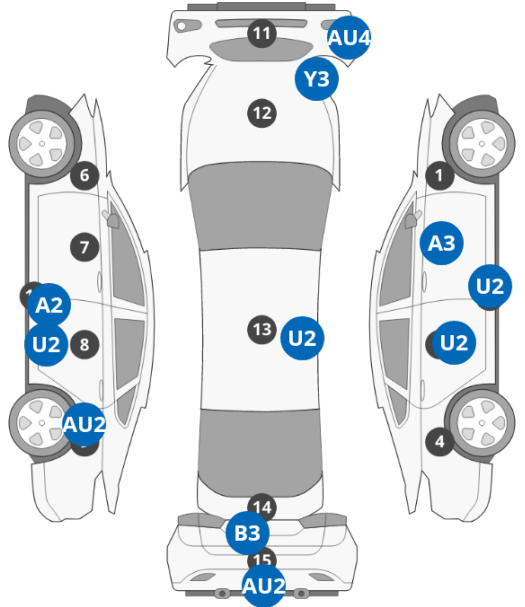
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	85.3	87	88	82
2	Boot Lid	87.1	89	83	89
3	Roof	86.5	85	80	94/86
4	Left Front Fender	85.0	88	84	83
5	Left Front Door	83.5	84	86	80
6	Center Panel Left				
7	Left Rear Door	83.8	86	81	85
8	Left Back Panel	87.2	80	95	87
9	Right Front Fender	81.6	81	83	82
10	Right Front Door	124.3	127	126	120
11	Center Panel Right				
12	Right Rear Door	135.0	141	127	137
13	Right Back Panel	89.2	88	84	96

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Large / Rear Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Crack, Gap - Medium / (R) Rear Door, Molding - Dent - Small / (R) Step, In-panel, Side Spoiler - Dent - Small / (R) Front Door, Molding - Scratch - Medium / Roof - Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Modified - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Remote Key & Smart entry - Issue - Yes / Head Light, High Beam - Issue - Yes / Horn - Issue - Yes

Inspector Notes
headlight issue/ incomplete tools/ scratches on tail lights/ with warranty booklet and LTO plate/ with jack and spare tire/ incomplete tools