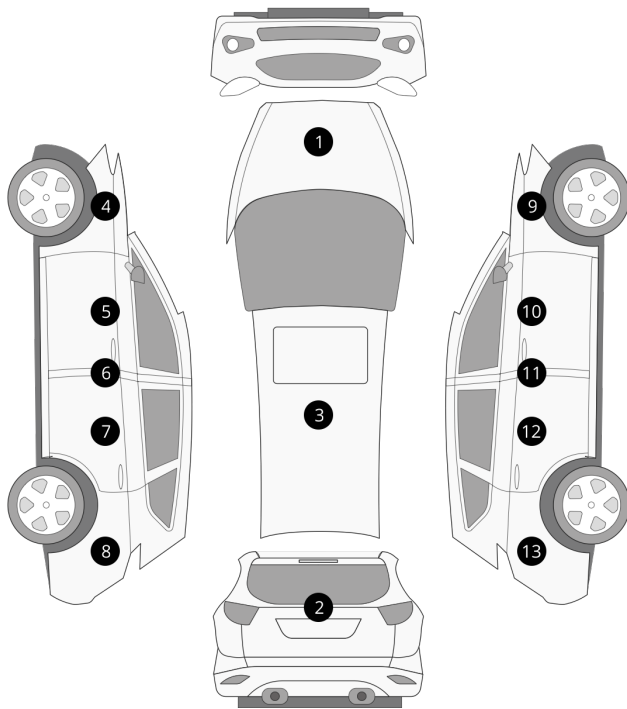


General Information

Date & Time: 28, Apr, 2025 17:51

Make	Toyota	Model	Vios
YOM	2024	Mileage	11,041
Registration No.	DBN1098	Chassis No.	PA1B18F34P4228791
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



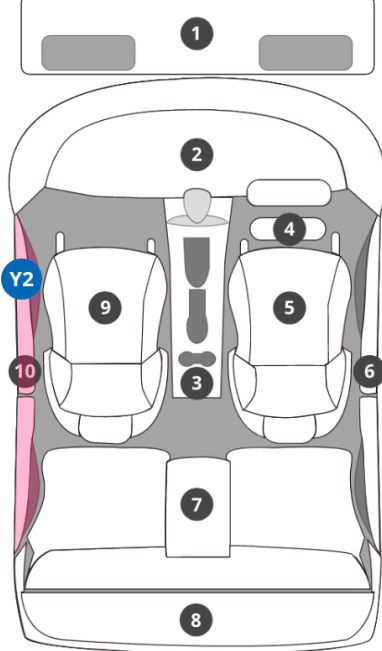
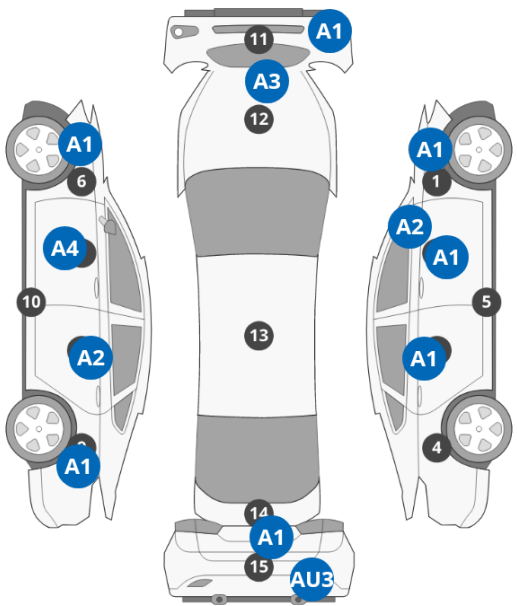
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	93.9	94	93	94
2	Boot Lid	98.2	91	103	101
3	Roof	95.0	103	91	95/91
4	Left Front Fender	93.3	90	92	98
5	Left Front Door	94.7	98	94	93
6	Center Panel Left				
7	Left Rear Door	100.8	109	98	95
8	Left Back Panel	106.5	113	109	98
9	Right Front Fender	98.5	101	105	90
10	Right Front Door	87.7	91	85	87
11	Center Panel Right				
12	Right Rear Door	94.6	90	89	105
13	Right Back Panel	97.6	94	93	106

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Small	Remarks Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate/with spare tire/with warranty booklets/with jack and incomplete tools/No reverse camera/left and right fender faded color/bonnet faded color