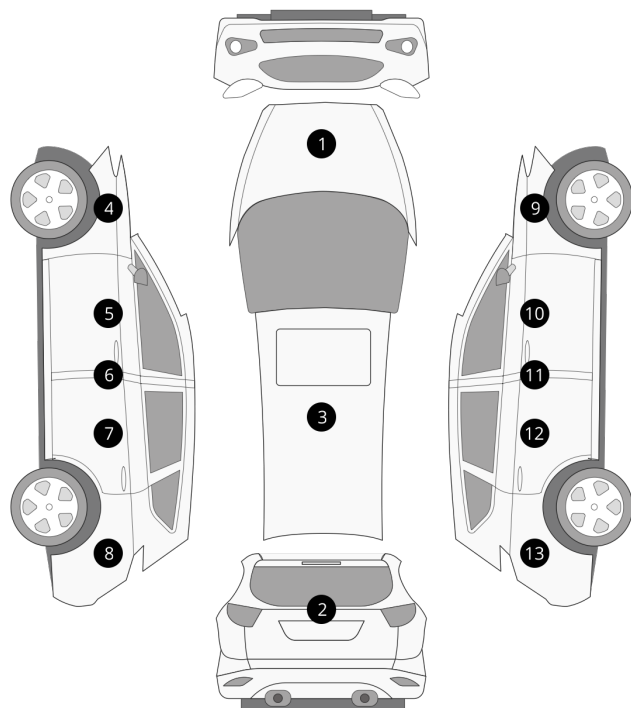


General Information

Date & Time: 29, Apr, 2025 11:21

Make	Toyota	Model	Vios
YOM	2023	Mileage	69,390
Registration No.	NFC5345	Chassis No.	PA1B18F34P4207911
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



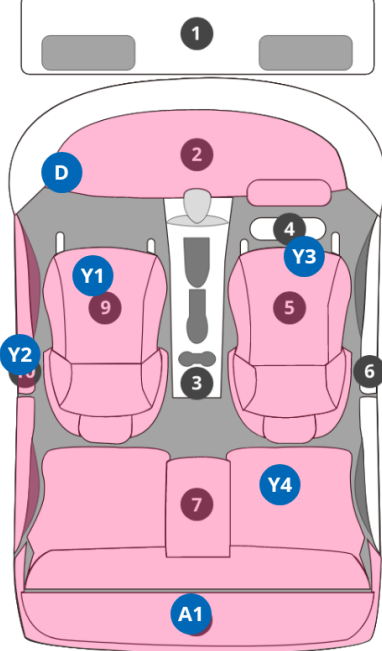
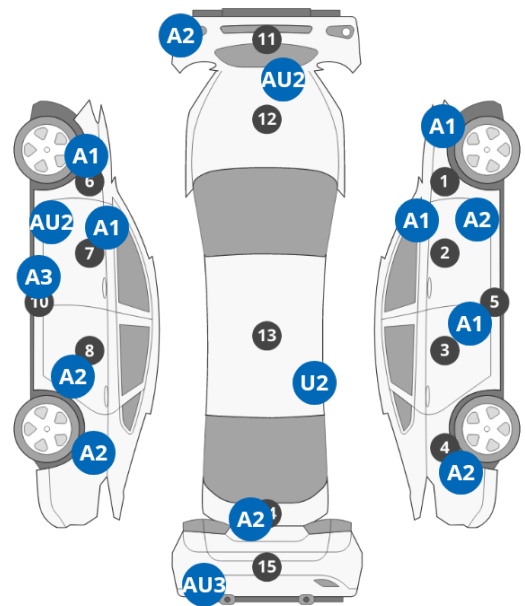
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.3	109	91	110
2	Boot Lid	97.4	90	102	100
3	Roof	87.3	90	91	82/86
4	Left Front Fender	86.3	92	82	85
5	Left Front Door	102.6	81	136	91
6	Center Panel Left				
7	Left Rear Door	88.9	96	88	83
8	Left Back Panel	95.4	98	91	97
9	Right Front Fender	84.8	87	81	87
10	Right Front Door	81.3	81	79	83
11	Center Panel Right				
12	Right Rear Door	87.2	87	84	90
13	Right Back Panel	89.7	91	82	97

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / Roof - Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, Incomplete tools, with jack, with spare tire, worn tires