


## General Information

Date & Time: 29, Apr, 2025 12:37

|                  |                   |              |                   |
|------------------|-------------------|--------------|-------------------|
| Make             | Toyota            | Model        | Vios              |
| YOM              | 2022              | Mileage      | 74,345            |
| Registration No. | NFE3396           | Chassis No.  | PA1B18F31N4180261 |
| CC               | 1.3               | Transmission | CVT               |
| Fuel Type        | Gas               | Type of Body | Sedan             |
| Colour           | Red Mica Metallic |              |                   |

## Body / Panel Condition

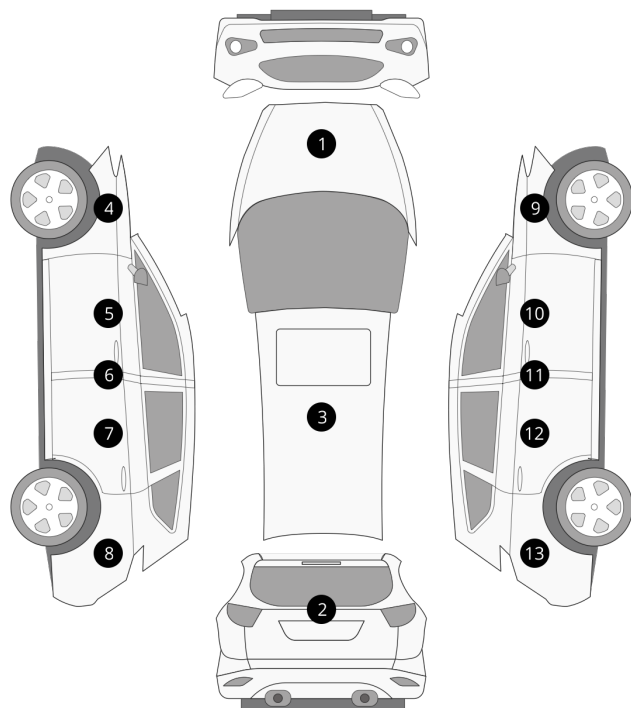


| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 94.8          | 94     | 94     | 96       |
| 2  | Boot Lid           | 90.0          | 89     | 88     | 94       |
| 3  | Roof               | 81.6          | 88     | 76     | 81/82    |
| 4  | Left Front Fender  | 88.6          | 87     | 90     | 89       |
| 5  | Left Front Door    | 89.4          | 97     | 90     | 81       |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 89.7          | 88     | 90     | 92       |
| 8  | Left Back Panel    | 94.8          | 92     | 95     | 98       |
| 9  | Right Front Fender | 83.7          | 87     | 82     | 82       |
| 10 | Right Front Door   | 88.3          | 90     | 85     | 90       |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 90.4          | 92     | 88     | 91       |
| 13 | Right Back Panel   | 90.9          | 86     | 88     | 100      |

## Overall Evaluation :

C

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.
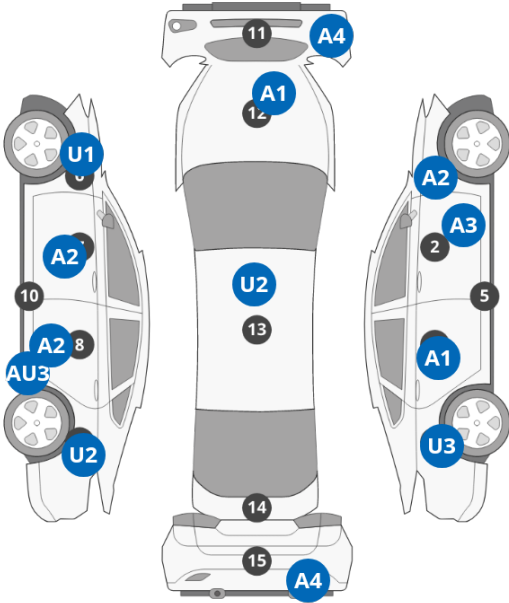
|                                                                                                                                                                                                                                                                                                                                                                                     |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Interior Evaluation :</b> <span style="color: red; font-weight: bold;">D</span>                                                                                                                                                                                                                                                                                                  | <b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold;">D</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |
| <div data-bbox="140 353 715 719" data-label="Image">  </div> <div data-bbox="65 1093 775 1153" data-label="Text"> <p> <b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain         </p> </div> | <div data-bbox="911 398 1422 999" data-label="Image">  </div> <div data-bbox="807 1077 1533 1167" data-label="Text"> <p> <b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap         </p> </div>                                                                                                                               |
| <b>Remarks</b><br>(L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / Rear Seat - Grime - Large / Trunk Room - Worn, Scratch, Cut, Crack - Medium / Ceiling - Grime - Medium / (L) Front Floor Mat - Grime - Medium                                                                                | <b>Remarks</b><br>Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Dent - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / (L) Front Fender, Molding - Dent - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Dent - Small / Roof - Dent - Small |
| <b>Frame Evaluation :</b> <span style="color: red; font-weight: bold;">A</span>                                                                                                                                                                                                                                                                                                     | <b>Functional Evaluation :</b> <span style="color: red; font-weight: bold;">B</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
| <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                                                                                                                                                 | <b>Remarks</b><br>Battery - Weak - Yes / Reverse Camera - N/A - Yes                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |

| Inspector Notes                                                                                                       |
|-----------------------------------------------------------------------------------------------------------------------|
| with LTO plate/with spare tire/with jack and incomplete tools/No warranty booklet/No reverse camera/plate light issue |