

General Information

Date & Time: 23, Apr, 2025 13:27

Make	Subaru	Model	Outback
YOM	2017	Mileage	120,953
Registration No.	NAV2255	Chassis No.	JF1BSFLC2HG114747
CC	3.6	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Gray		

Body / Panel Condition



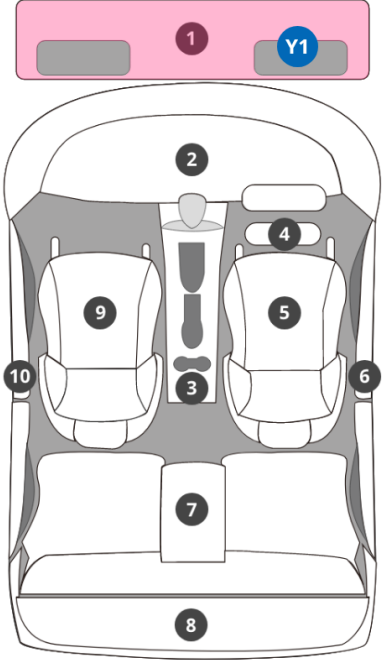
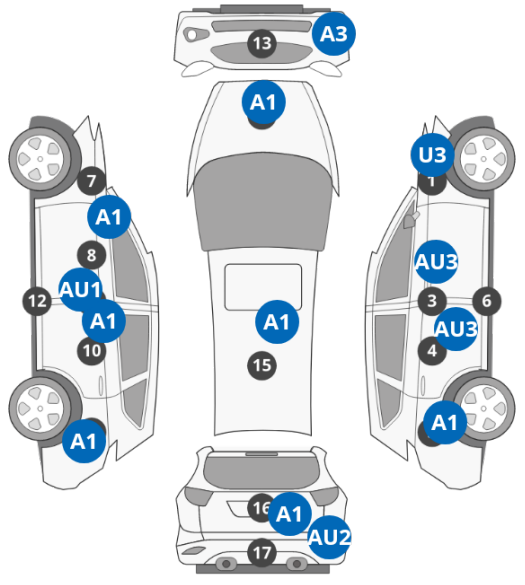
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.7	96	96	117
2	Boot Lid	110.3	105	114	112
3	Roof	111.2	108	112	115/110
4	Left Front Fender	101.7	116	99	91
5	Left Front Door	118.6	124	114	118
6	Center Panel Left				
7	Left Rear Door	101.8	108	101	96
8	Left Back Panel	112.6	101	113	124
9	Right Front Fender	105.3	102	101	113
10	Right Front Door	114.6	115	115	114
11	Center Panel Right				
12	Right Rear Door	100.7	95	105	102
13	Right Back Panel	113.6	123	114	104

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal	Remarks (R) Front Fender, Molding - Dent - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, with jack and tools, with spare tire/shallow dent on right front and rear Door