

General Information

Date & Time: 23, Apr, 2025 08:42

Make	Toyota	Model	Vios
YOM	2023	Mileage	64,181
Registration No.	NHI7046	Chassis No.	PA1B18F3XP4209016
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



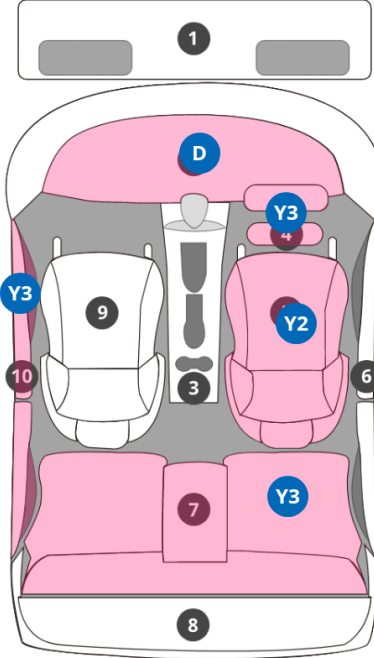
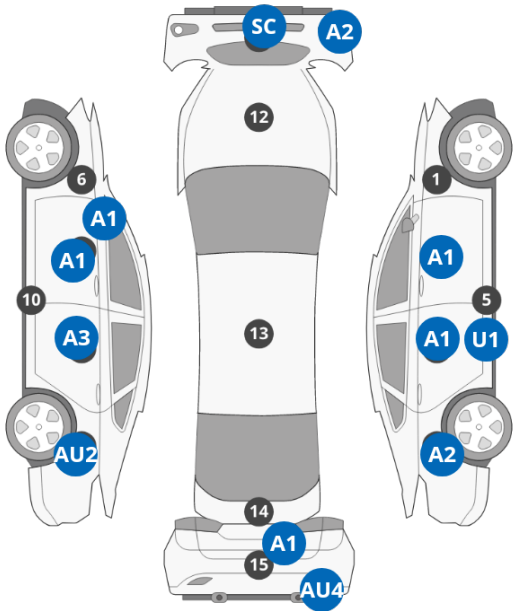
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.5	100	92	101
2	Boot Lid	98.8	100	95	102
3	Roof	92.0	100	90	89/89
4	Left Front Fender	91.0	91	87	95
5	Left Front Door	91.1	94	91	88
6	Center Panel Left				
7	Left Rear Door	99.7	100	98	101
8	Left Back Panel	102.0	114	98	94
9	Right Front Fender	94.6	98	94	92
10	Right Front Door	91.3	94	88	92
11	Center Panel Right				
12	Right Rear Door	93.2	86	90	104
13	Right Back Panel	95.2	94	88	104

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Medium / (L) Front Trim - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Small / Rear Seat - Grime - Medium	Remarks Member (Bolted) - Rust, Corrosion - Yes / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (R) Step, In-panel, Side Spoiler - Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/with spare tire/No jack and tools/No warranty booklet/No reverse camera