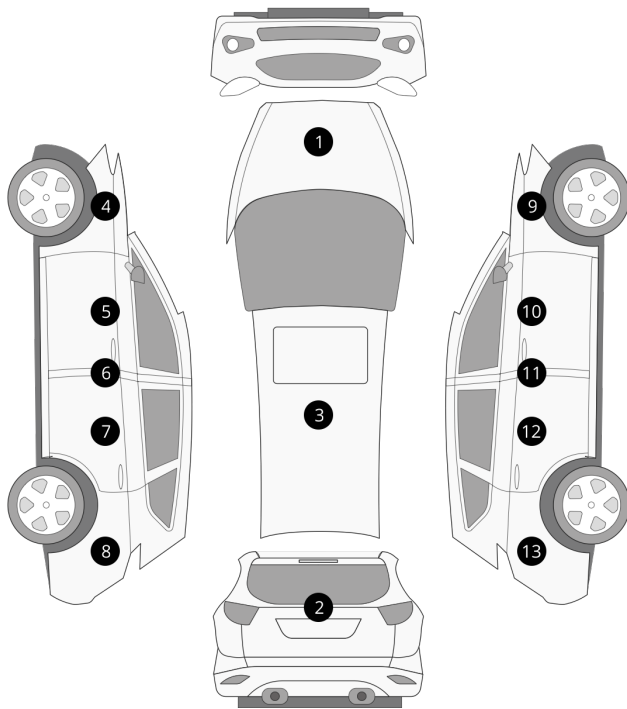


General Information

Date & Time: 28, Apr, 2025 16:59

Make	Toyota	Model	Vios
YOM	2023	Mileage	21,265
Registration No.	NIQ3505	Chassis No.	PA1B18F38P4224937
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



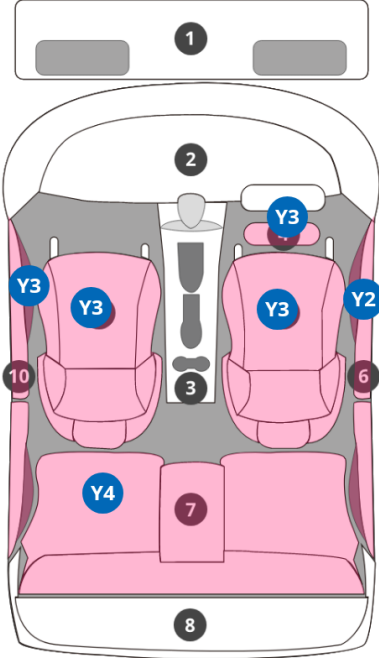
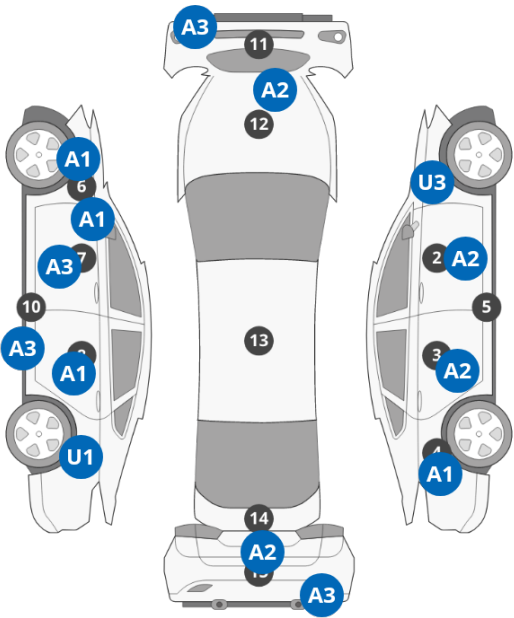
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.9	104	93	100
2	Boot Lid	95.8	88	100	100
3	Roof	83.5	87	83	77/87
4	Left Front Fender	86.4	82	88	89
5	Left Front Door	94.5	93	105	86
6	Center Panel Left				
7	Left Rear Door	116.0	115	113	120
8	Left Back Panel	98.1	124	89	81
9	Right Front Fender	91.2	94	90	90
10	Right Front Door	92.6	90	97	91
11	Center Panel Right				
12	Right Rear Door	91.5	92	86	96
13	Right Back Panel	91.0	88	94	92

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C		Exterior Evaluation : D	
			
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Large / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Medium		Remarks Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Rear Fender, Molding - Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal	
Frame Evaluation : A		Functional Evaluation : A	
Remarks Defects not found		Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist	

Inspector Notes

with LTO plate/with spare tire/with warranty booklet/incomplete tools/No jack/No reverse camera