

General Information

Date & Time: 28, Apr, 2025 08:53

Make	Toyota	Model	Vios
YOM	2025	Mileage	12,638
Registration No.	NEY7602	Chassis No.	PA1B18F38R4263711
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



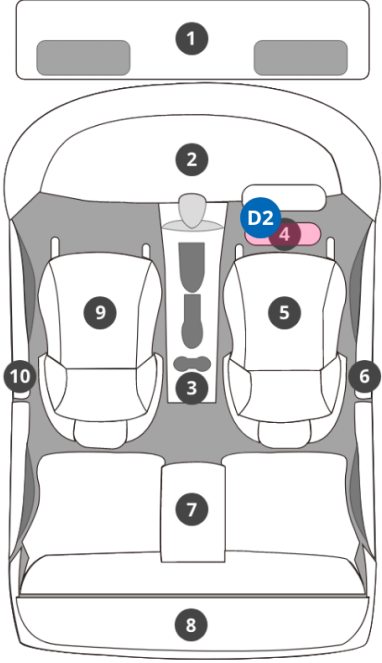
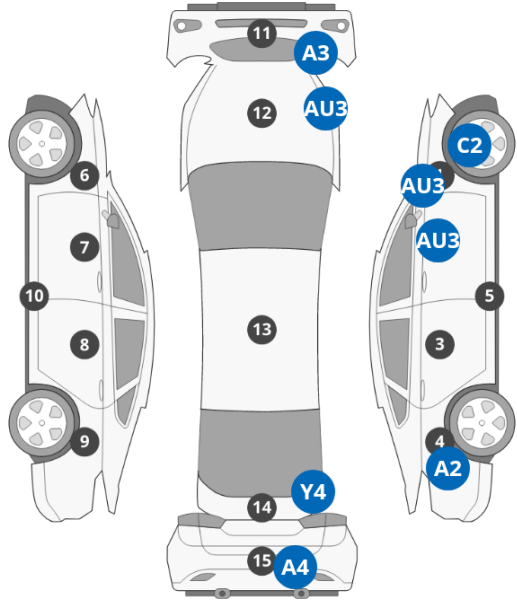
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	92.7	91	94	94
2	Boot Lid	89.6	90	90	89
3	Roof	86.1	91	86	84/84
4	Left Front Fender	82.5	85	81	82
5	Left Front Door	85.4	80	85	91
6	Center Panel Left				
7	Left Rear Door	88.8	98	88	81
8	Left Back Panel	94.2	100	96	87
9	Right Front Fender	84.6	82	83	89
10	Right Front Door	86.9	90	83	88
11	Center Panel Right				
12	Right Rear Door	88.1	88	86	91
13	Right Back Panel	93.0	90	91	99

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small	Remarks Bonnet, Headlight - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Crack, Gap - Large / (R) Rear Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Wheel, Cover - Scratch, Corrosion - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet/ with spare tire and jack/ with LTO plate/ incomplete tools