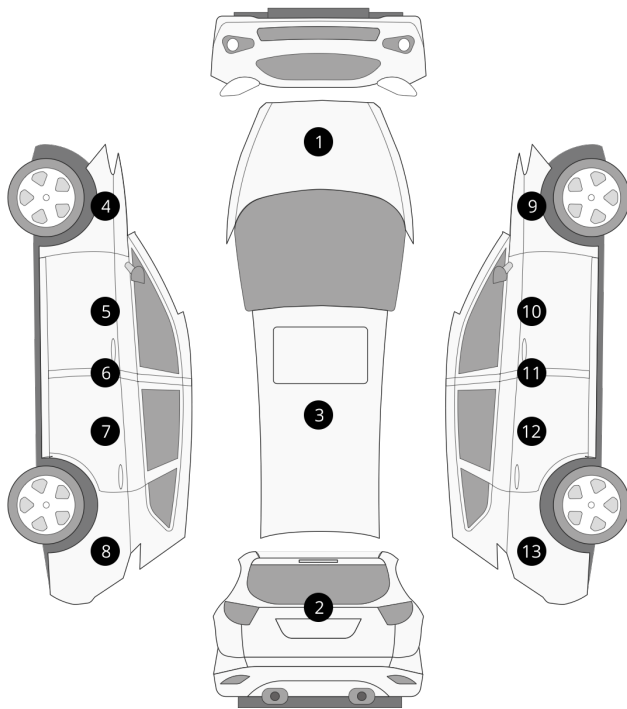


General Information

Date & Time: 24, Apr, 2025 08:39

Make	Toyota	Model	Wigo
YOM	2022	Mileage	82,252
Registration No.	NFD2379	Chassis No.	MHKA4DF5FMJ063595
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Black		

Body / Panel Condition



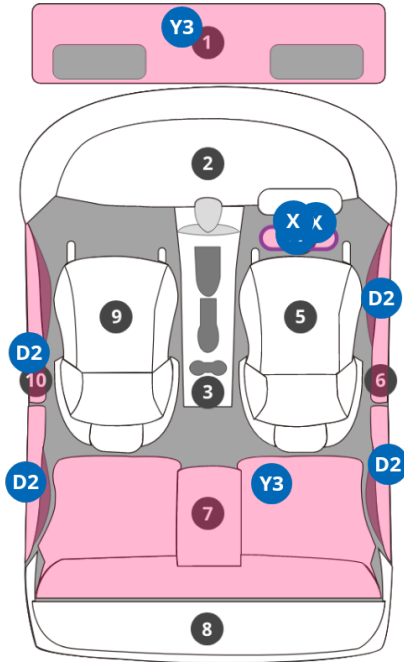
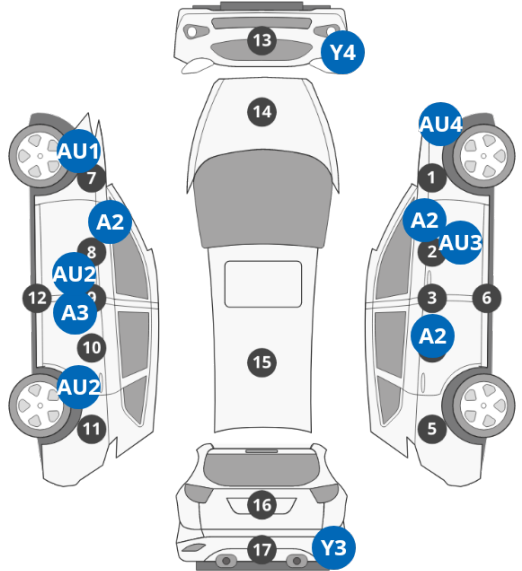
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	74.6	86	72	66
2	Boot Lid	80.1	78	80	82
3	Roof	72.1	65	77	77/70
4	Left Front Fender	75.9	75	80	73
5	Left Front Door	77.0	76	79	76
6	Center Panel Left				
7	Left Rear Door	76.4	76	78	76
8	Left Back Panel	74.4	76	77	71
9	Right Front Fender	79.3	77	80	80
10	Right Front Door	78.0	77	79	79
11	Center Panel Right				
12	Right Rear Door	75.9	76	74	77
13	Right Back Panel	78.5	77	76	83

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Medium / (R) Front Trim - Worked - Small / (L) Front Trim - Worked - Small / (L) Rear Trim - Worked - Small / (R) Rear Trim - Worked - Small / Ceiling - Grime - Medium	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Mirror - Scratch - Small / (L) Mirror - Scratch - Small
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Door Lock - Issue - Yes / Power Steering - Issue - Yes / Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, no jack, no tools, with spare tire, with LTO plate, weak battery, power steering issue due to weak battery, air bag indicator (on), horn issue, fog light issue, door lock issue, scratches on tail light , rear passenger assist handle, rear left door weather strip missing