

General Information

Date & Time: 24, Apr, 2025 08:40

Make	Toyota	Model	Vios
YOM	2023	Mileage	22,203
Registration No.	CBI4275	Chassis No.	PA1B18F36P4213791
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



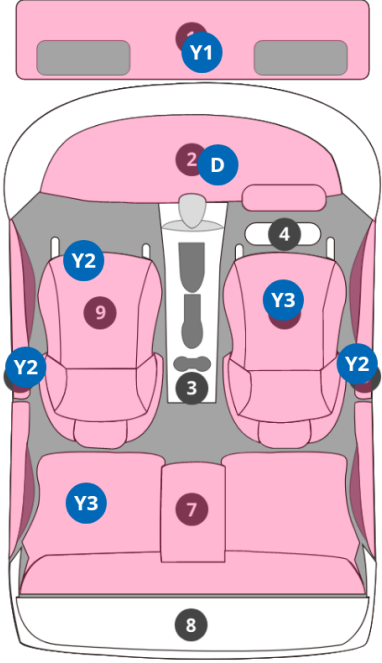
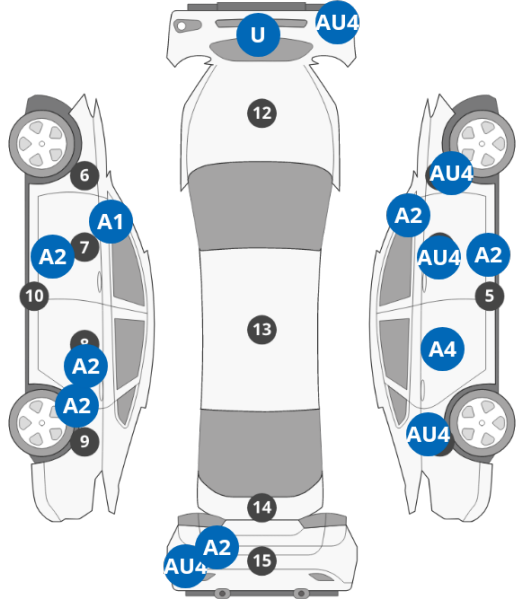
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	108	109	111
2	Boot Lid	109.0	104	110	113
3	Roof	94.2	96	95	93/93
4	Left Front Fender	101.9	99	108	98
5	Left Front Door	98.0	95	98	101
6	Center Panel Left				
7	Left Rear Door	98.2	102	100	93
8	Left Back Panel	99.2	106	93	99
9	Right Front Fender	112.3	111	109	117
10	Right Front Door	117.3	122	119	111
11	Center Panel Right				
12	Right Rear Door	225.6	229	235	213
13	Right Back Panel	183.0	188	167	194

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Step - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With warranty booklet and spare tire. Without tools and jack.No seat cover. 1 key. With LTO plate.