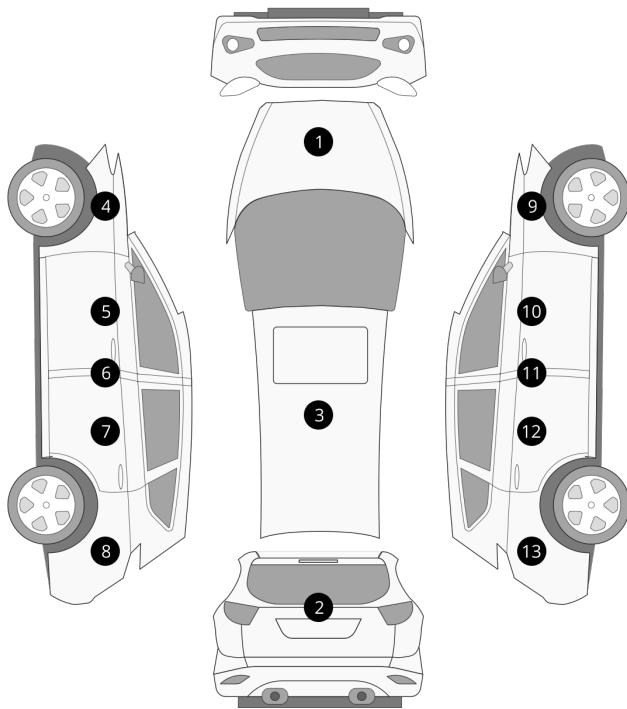


General Information

Date & Time: 28, Apr, 2025 15:15

Make	Toyota	Model	Vios
YOM	2023	Mileage	18,865
Registration No.	EAG1151	Chassis No.	PA1B18F31N4193947
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



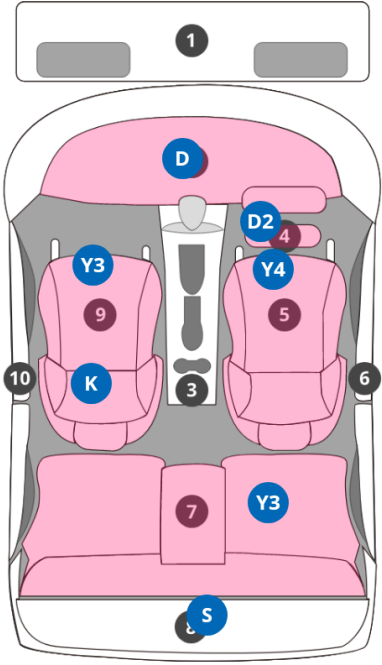
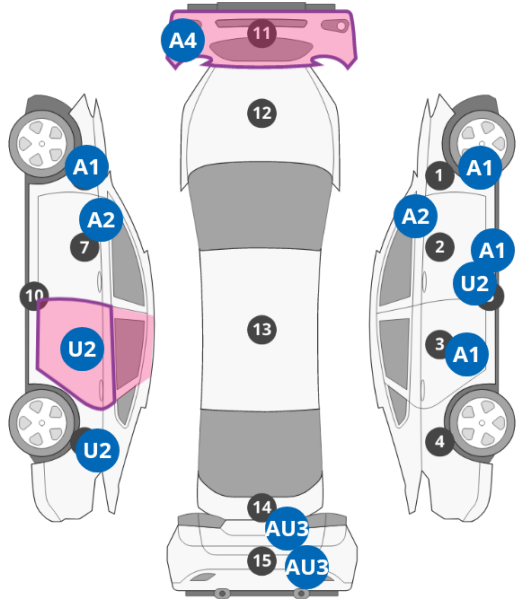
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.2	102	93	109
2	Boot Lid	95.3	95	95	96
3	Roof	87.6	89	86	83/92
4	Left Front Fender	86.5	89	89	82
5	Left Front Door	86.2	82	90	87
6	Center Panel Left				
7	Left Rear Door	89.3	87	92	89
8	Left Back Panel	100.1	105	99	96
9	Right Front Fender	91.5	85	95	94
10	Right Front Door	92.1	88	92	97
11	Center Panel Right				
12	Right Rear Door	92.7	91	92	95
13	Right Back Panel	96.3	87	92	110

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Animal Hair - Yes / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / Rear Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Smell - Yes	Remarks (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (L) Rear Door, Molding - Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Dent - Small / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

with warranty booklet and LTO plate/ with spare tire and jack/ incomplete tools/