

General Information

Date & Time: 28, Apr, 2025 12:29

Make	Toyota	Model	Vios
YOM	2021	Mileage	40,299
Registration No.	NGL9550	Chassis No.	PA1B18F38M4138572
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



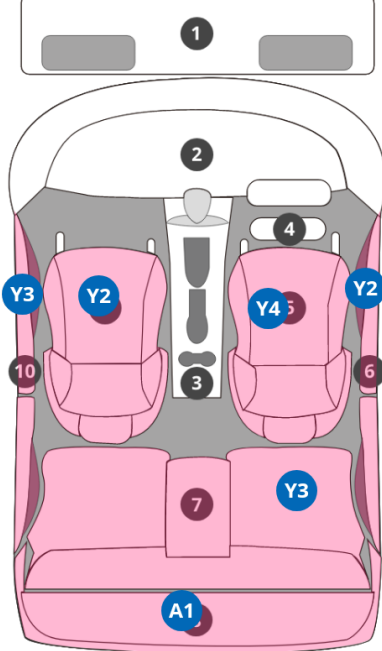
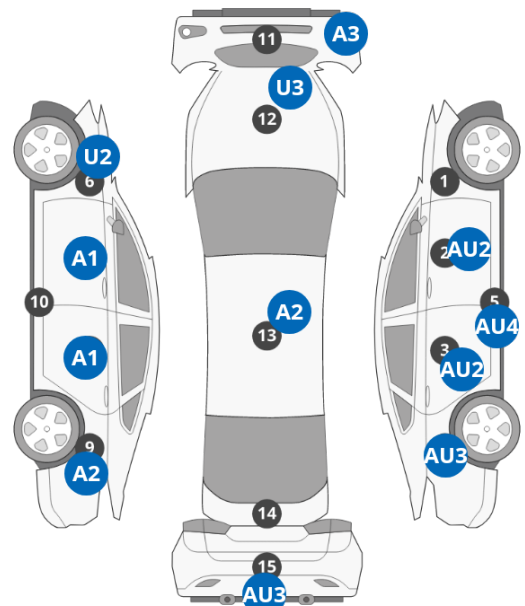
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.3	102	99	103
2	Boot Lid	96.9	95	97	99
3	Roof	86.8	92	87	86/83
4	Left Front Fender	86.9	88	86	88
5	Left Front Door	88.9	87	86	94
6	Center Panel Left				
7	Left Rear Door	87.8	97	86	81
8	Left Back Panel	93.1	94	93	92
9	Right Front Fender	92.7	98	93	88
10	Right Front Door	93.1	89	93	97
11	Center Panel Right				
12	Right Rear Door	89.8	87	87	96
13	Right Back Panel	93.0	86	90	103

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / (R) Front Trim - Grime - Small	Remarks Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / Bonnet, Headlight - Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate/with spare tire/with jack and tools/with warranty booklet/No reverse camera